

**Tree condition survey**  
at  
**The Butts Public Open Space, Alton**  
for  
**Alton Town Council**

**sapling arboriculture ltd**

Ben Abbatt  
Dip. Arb. (RFS), BA (Hons), MICFor, MRICS, CEnv  
Arboricultural Association Registered Consultant



Holbache Mount Pleasant Road, Alton, Hants,  
GU34 2RS

t: 01420 550 160  
e: [enquiries@saplingarboriculture.com](mailto:enquiries@saplingarboriculture.com)  
w: [www.saplingarboriculture.com](http://www.saplingarboriculture.com)

Reference: J064.16.01  
March 2020



## **Contents**

Instruction

Tree condition survey

General notes

Key

Site plan

## **Instruction**

The tree survey is to be carried out in relation to the landowner's duty under the Occupier's Liability Act 1984 and common law. The tree survey will be carried out from ground level, identifying significant tree features that may have significant bearing upon the condition and management of the tree and giving appropriate recommendations and priorities.

Typical significant defects that are to be identified can be referred to in "Hazards from Trees, a general guide" by David Lonsdale and "The body language of trees" by Claus Mattheck published by the Forestry Commission and the Department of the Environment respectively.

## Tree Condition Survey Sheet

Site: The Butts public open space

Date: 30<sup>th</sup> March 2020

Weather: Clear with light wind.

Surveyed by: Ben Abbatt

| No | Species        | Age class | Condition<br>(Physiological and structural)                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                     | Recommendations                                                                                                                          | Priority for works |
|----|----------------|-----------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------------------------------------------------------------------------------------------------------------------------------|--------------------|
| T1 | Horse Chestnut | Mature    | <b>Fair</b><br>Intermediate canopy.<br>Slightly sparse twig density.<br>Crown grows predominantly to North away from T2.<br>Three large stems from 2 - 2.5m with tight forks.<br>Mechanical damage to base and roots.<br>Longitudinal seam on opposing East and West sides of stem from 2m to 1m.                                                                                                                                                                                                                                                               | No works required at time of survey.                                                                                                     | -                  |
| T2 | Horse Chestnut | Mature    | <b>Fair</b><br>Intermediate canopy.<br>Slightly sparse foliage.<br>Three large stems from 2 - 2.5m, good unions.<br>Evidence of past branch failure in crown.<br>Bark cracking and loss from buttress on South West side.<br>Southern stem sub divides.<br>Shorter stem lost upper part of canopy.<br>Stem wound at c12m with cable bracing above.<br>Additional nylon bracing visible at c12-14m between 3 stems.<br>Wood degradation visible in top of shorter stem on South side.<br>Bark cracks & exudate commensurate with Horse Chestnut Bleeding Canker. | Replace nylon cable bracing system.                                                                                                      | Low                |
| T3 | Horse Chestnut | Young     | <b>Removed</b>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                  | Plant replacement tree (Tulip tree <i>Liriodendron tulipifera</i> or Sweet Chestnut <i>Castanea sativa</i> or Elm <i>Ulmus lutece</i> ). | Low                |

| No | Species        | Age class | Condition<br>(Physiological and structural)                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                       | Recommendations                                                                                                                                                                                                                                                                                              | Priority for works                    |
|----|----------------|-----------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------------------------------|
| T4 | Horse Chestnut | Young     | <b>Good</b><br>Dominant canopy.<br>Moderate mechanical damage to base and roots.                                                                                                                                                                                                                                                                                                                                                                                                                                                                                  | Cut turf and remove within 0.5m radius of tree base to depth of 50mm and replace with wood chip to settled depth of 75mm.<br><br>Crown lift to 3m all round and 5m over the carriageway to natural target pruning points.                                                                                    | Moderate<br><br>Low                   |
| T5 | Horse Chestnut | Young     | <b>Poor</b><br>Low small branches rubbing on weld mesh guard.<br>Mechanical damage to base and roots.                                                                                                                                                                                                                                                                                                                                                                                                                                                             | Remove.<br><br>Plant replacement tree (Tulip tree <i>Liriodendron tulipifera</i> or Sweet Chestnut <i>Castanea sativa</i> or Elm <i>Ulmus lutece</i> ).<br><br>Cut and remove turf within 0.5m radius of tree base to depth of 50mm and replace with wood chip to settled depth of 75mm.                     | Low<br><br>Low<br><br>Low             |
| T6 | Horse Chestnut | Mature    | <b>Poor</b><br>Dominant canopy.<br>Slightly sparse twig density in particular in upper canopy.<br>Numerous stems from 2.5 - 3m, 2 tight unions.<br>Past pruning wound on East side now a cavity opening, good wound wood.<br>Mechanical damage to base and roots.<br>6 other significant wounds between 4-6m at base of main stems.<br>Good reactive growing but potential areas of internal wood degradation.<br>Series of strips of dead bark on lower stem.<br>Dark exudate commensurate with Horse Chestnut Bleeding Canker.<br>Decay at union between stems. | Remove.<br><br>Grind stump.<br><br>Plant replacement tree (Tulip tree <i>Liriodendron tulipifera</i> or Sweet Chestnut <i>Castanea sativa</i> or Elm <i>Ulmus lutece</i> ).<br><br>Cut and remove turf within 0.5m radius of tree base to depth of 50mm and replace with wood chip to settled depth of 75mm. | High<br><br>Low<br><br>Low<br><br>Low |
| T7 | Horse Chestnut | Young     | <b>Good</b><br>Dominant canopy.<br>Low branches over footway and carriageway.<br>Mechanical damage to base and roots.                                                                                                                                                                                                                                                                                                                                                                                                                                             | Cut turf and remove within 0.5m radius of tree base to depth of 50mm and replace with wood chip to settled depth of 75mm.<br><br>Crown lift to 3m all round and 5m over the carriageway to natural target pruning points.                                                                                    | Low<br><br>Low                        |

| No  | Species        | Age class   | Condition<br>(Physiological and structural)                                                                                                                                                                                                                                                      | Recommendations                                                                                                                          | Priority for works |
|-----|----------------|-------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------------------------------------------------------------------------------------------------------------------------------|--------------------|
| T8  | Horse Chestnut | Young       | <b>Good</b><br>Low branches over footway.<br>Mechanical damage to base and roots.                                                                                                                                                                                                                | Cut turf and remove within 0.5m radius of tree base to depth of 50mm and replace with wood chip to settled depth of 75mm.                | Low                |
| T9  | Horse Chestnut | -           | <b>Removed</b>                                                                                                                                                                                                                                                                                   | -                                                                                                                                        | -                  |
| T10 | London Plane   | Young       | <b>Good</b>                                                                                                                                                                                                                                                                                      | Cut turf and remove within 0.5m radius of tree base to depth of 50mm and replace with wood chip to settled depth of 75mm.                | Low                |
| T11 | Horse Chestnut | -           | <b>Removed</b>                                                                                                                                                                                                                                                                                   | -                                                                                                                                        | -                  |
| T12 | Manna Ash      | Middle aged | <b>Good</b><br>Intermediate canopy.<br>Low branches over footway and carriageway.                                                                                                                                                                                                                | Crown lift to 3m all round and 5m over the carriageway to natural target pruning points.                                                 | Low                |
| T13 | Manna Ash      | Middle aged | <b>Good</b><br>Intermediate canopy.<br>Top recently removed.<br>Partly suppressed under crown of railway sycamore.<br>Low branches over footway.                                                                                                                                                 | Crown lift to 3m all round and 5m over the carriageway to natural target pruning points.                                                 | Low                |
| T14 | Ash            | Middle aged | <b>Removed</b>                                                                                                                                                                                                                                                                                   | -                                                                                                                                        | -                  |
| T15 | Ash            | Mature      | <b>Fair</b><br>Single stem with slight lean towards and over adjacent railway embankment.<br>Deadwood in upper canopy.<br>Bacterial canker evident on branch work but not extensive at this time.<br>Bark wound on the south side at c1.5m commensurate with recent adjacent construction works. | Remove deadwood more than 25mm diameter.<br><br>Crown lift to 3m all round and 5m over the carriageway to natural target pruning points. | Low<br><br>Low     |

| No  | Species        | Age class | Condition<br>(Physiological and structural)                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                      | Recommendations                                                                                                                                                                                                                                                                                              | Priority for works                        |
|-----|----------------|-----------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------------------------------|
| T16 | Birch          | Mature    | <b>Fair</b><br>Intermediate canopy.<br>Areas of bud proliferation throughout crown.<br>Twiggy deadwood.<br>Anticipate altered exposure due to loss of tree T17.                                                                                                                                                                                                                                                                                                                                                                                  | No works required at time of survey.                                                                                                                                                                                                                                                                         | -                                         |
| T17 | Ash            | Mature    | <b>Poor</b><br>Intermediate canopy.<br>Sparse upper canopy commensurate with ash dieback.<br>Typical occasional moderate (25 - 100mm diameter) deadwood throughout.<br>Overlong branches to West at c6m over open space.                                                                                                                                                                                                                                                                                                                         | Remove.<br><br>Grind stump.<br><br>Plant replacement tree (Tulip tree <i>Liriodendron tulipifera</i> or Sweet Chestnut <i>Castanea sativa</i> or Elm <i>Ulmus lutece</i> ).<br><br>Cut and remove turf within 0.5m radius of tree base to depth of 50mm and replace with wood chip to settled depth of 75mm. | Moderate<br><br>Low<br><br>Low<br><br>Low |
| T18 | Sweet Chestnut | Young     | <b>Good</b>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                      | Cut turf and remove within 0.5m radius of tree base to depth of 50mm and replace with wood chip to settled depth of 75mm.<br><br>Crown lift to 3m all round and 5m over the carriageway to natural target pruning points.                                                                                    | Low<br><br>Low                            |
| T19 | Horse Chestnut | Mature    | <b>Fair</b><br>Slightly sparse twig density in upper canopy.<br>Metal cable bracing at 6m, fibre cable bracing at 8m.<br>Historic failed primary branch above street light with mature regrowth.<br>Pruning wound cavity on South West side at 2m has been filled with concrete.<br>Wound on stem at 200mm to 1000mm exposing wood.<br>Buttress roots on carriageway side down to carriageway edge.<br>Scar of dysfunctional bark on South East side of stem from 2m to ground level.<br>Significant bark loss on lower stem with decay beneath. | Remove.<br><br>Grind stump.<br><br>Plant replacement tree (Tulip tree <i>Liriodendron tulipifera</i> or Sweet Chestnut <i>Castanea sativa</i> or Elm <i>Ulmus lutece</i> ).<br><br>Cut and remove turf within 0.5m radius of tree base to depth of 50mm and replace with wood chip to settled depth of 75mm. | High<br><br>Low<br><br>Low<br><br>Low     |

| No  | Species        | Age class   | Condition<br>(Physiological and structural)                                                                                                                                                                                                                                                                                                                                         | Recommendations                                                                                                           | Priority for works  |
|-----|----------------|-------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------------------------------------------------------------------------------------------------------------------|---------------------|
| T20 | Horse Chestnut | Mature      | <b>Fair</b><br>Intermediate canopy.<br>Sparse canopy.<br>Three large stems from 4m, good unions.                                                                                                                                                                                                                                                                                    | No works required at the time of the survey.                                                                              |                     |
| T21 | Horse Chestnut | Mature      | <b>Fair</b><br>Dominant canopy.<br>Dense epicormic adventitious growth from stem and branches to c9m impeding survey.<br>Minor bark cracking on branches over carriageway.<br>Historic failed primary branch to South with mature regrowth.<br>Three large stems from 4m with unions obscured in part by dense epicormic growth.<br>Hanging deadwood in west canopy c60mm diameter. | Annual removal of epicormic growth to 3m.<br><br>Remove deadwood more than 25mm diameter.                                 | Low<br><br>Moderate |
| T22 | Horse Chestnut | Middle Aged | <b>Good</b><br>Dominant canopy.<br>Mechanical damage at base.                                                                                                                                                                                                                                                                                                                       | Cut turf and remove within 0.5m radius of tree base to depth of 50mm and replace with wood chip to settled depth of 75mm. | Low                 |
| T23 | Horse Chestnut | Mature      | <b>Fair</b><br>Dominant canopy.<br>Slightly sparse canopy throughout.<br>Two large stems from 3m.<br>Wound on East side just below main union (previously concreted).<br>Wound on North side just below main union (previously concreted).<br>Overlong branches over carriageway.                                                                                                   | No works required at time of survey.                                                                                      | -                   |
| T24 | Sweet Chestnut | Young       | <b>Good</b>                                                                                                                                                                                                                                                                                                                                                                         | Cut turf and remove within 0.5m radius of tree base to depth of 50mm and replace with wood chip to settled depth of 75mm. | Low                 |



| No  | Species        | Age class | Condition<br>(Physiological and structural)                                                                                                                                                               | Recommendations                                                                                                                                                                                                                                                                                                       | Priority for works                   |
|-----|----------------|-----------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|--------------------------------------|
| T25 | Tulip tree     | Young     | <b>Dead</b>                                                                                                                                                                                               | Remove.<br><br>Grind / remove stump.<br><br>Plant replacement tree (Tulip tree <i>Liriodendron tulipifera</i> or Sweet Chestnut <i>Castanea sativa</i> or Elm <i>Ulmus lutece</i> ).<br><br>Cut and remove turf within 0.5m radius of tree base to depth of 50mm and replace with wood chip to settled depth of 75mm. | Low<br><br>Low<br><br>Low<br><br>Low |
| T26 | Horse Chestnut | Young     | <b>Fair</b><br>Wound on stem at 1.8m.<br>Moderate mechanical damage at base.                                                                                                                              | Remove.<br><br>Grind / remove stump.<br><br>Plant replacement tree (Tulip tree <i>Liriodendron tulipifera</i> or Sweet Chestnut <i>Castanea sativa</i> or Elm <i>Ulmus lutece</i> ).<br><br>Cut and remove turf within 0.5m radius of tree base to depth of 50mm and replace with wood chip to settled depth of 75mm. | Low<br><br>Low<br><br>Low<br><br>Low |
| T27 | Tulip tree     | Young     | <b>Good</b><br>Dominant canopy.<br>Severe mechanical damage at base.                                                                                                                                      | Cut turf and remove within 0.5m radius of tree base to depth of 50mm and replace with wood chip to settled depth of 75mm.<br><br>Crown lift to 5m over the carriageway to natural target pruning points.                                                                                                              | Low<br><br>Low                       |
| T28 | Horse Chestnut | Mature    | <b>Good</b><br>Overlong lateral branches.<br>Strips of dead bark on North side commensurate with Horse Chestnut Bleeding Canker, particularly on the south west side.<br>Minor mechanical damage at base. | Cut turf and remove within 0.5m radius of tree base to depth of 50mm and replace with wood chip to settled depth of 75mm.<br><br>Crown reduction to form horizontal branch length of 8 to 9m.                                                                                                                         | Low<br><br>Low                       |

| No  | Species        | Age class   | Condition<br>(Physiological and structural)                                                                                   | Recommendations                                                                                                                                                                                                                                                                                                                      | Priority for works        |
|-----|----------------|-------------|-------------------------------------------------------------------------------------------------------------------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------------------|
| T29 | Horse Chestnut | Middle Aged | <b>Removed</b>                                                                                                                | Grind / remove stump.<br><br>Plant replacement tree (Tulip tree <i>Liriodendron tulipifera</i> or Sweet Chestnut <i>Castanea sativa</i> or Elm <i>Ulmus lutece</i> ).<br><br>Cut and remove turf within 0.5m radius of tree base to depth of 50mm and replace with wood chip to settled depth of 75mm.                               | Low<br><br>Low<br><br>Low |
| T30 | Sweet Chestnut | Young       | <b>Removed</b>                                                                                                                | Grind / remove stump.<br><br>Plant replacement tree (Tulip tree <i>Liriodendron tulipifera</i> or Sweet Chestnut <i>Castanea sativa</i> or Elm <i>Ulmus lutece</i> ).<br><br>Cut and remove turf within 0.5m radius of tree base to depth of 50mm and replace with wood chip to settled depth of 75mm.                               | Low<br><br>Low<br><br>Low |
| T31 | Tulip Tree     | Young       | <b>Good</b><br>Grass grown at base.<br><br>(Replacement for Red Horse Chestnut previously recorded).                          | Cut turf and remove within 0.5m radius of tree base to depth of 50mm and replace with wood chip to settled depth of 75mm.<br><br>Remove guard and reposition to avoid contact with the tree avoiding rubbing damage to the stem.                                                                                                     | Low<br><br>Low            |
| T32 | Ash            | Mature      | <b>Fair</b><br>Previously intermediate canopy, now dominant. Slightly sparse canopy.<br>Overlong branches to North and South. | Cut turf and remove within 0.5m radius of tree base to depth of 50mm and replace with wood chip to settled depth of 75mm.<br><br>Plant replacement tree (Tulip tree <i>Liriodendron tulipifera</i> or Sweet Chestnut <i>Castanea sativa</i> or Elm <i>Ulmus lutece</i> ) in anticipate ion of loss in near future (within 20 years). | Low<br><br>Low            |

| No  | Species        | Age class | Condition<br>(Physiological and structural)                                                                                                                                                                                                                                                                                                                                                     | Recommendations                                                                                                                                                                                                                                                           | Priority for works       |
|-----|----------------|-----------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|--------------------------|
| T33 | Birch          | -         | <b>Removed</b>                                                                                                                                                                                                                                                                                                                                                                                  | Plant replacement tree (Tulip tree <i>Liriodendron tulipifera</i> or Sweet Chestnut <i>Castanea sativa</i> or Elm <i>Ulmus lutece</i> ).<br><br>Cut and remove turf within 0.5m radius of tree base to depth of 50mm and replace with wood chip to settled depth of 75mm. | Low<br><br>Low           |
| T34 | Birch          | -         | <b>Removed</b>                                                                                                                                                                                                                                                                                                                                                                                  | Plant replacement tree (Tulip tree <i>Liriodendron tulipifera</i> or Sweet Chestnut <i>Castanea sativa</i> or Elm <i>Ulmus lutece</i> ).<br><br>Cut and remove turf within 0.5m radius of tree base to depth of 50mm and replace with wood chip to settled depth of 75mm. | Low<br><br>Low           |
| T35 | Horse Chestnut | Mature    | <b>Fair</b><br>Intermediate canopy.<br>Minor deadwood (less than 25mm diameter) throughout.<br>Strips of dead bark on lower stem.<br>Topped at 9m with mature regrowth.<br>Two large stems from 4m, good union.<br>Overlong branches over carriageway.                                                                                                                                          | Inspect for decay and wood degradation in top of North (roadside) stem for extent of residual wall supporting mature regrowth.<br><br>Cut turf and remove within 0.5m radius of tree base to depth of 50mm and replace with wood chip to settled depth of 75mm.           | Moderate<br><br>Moderate |
| T36 | Horse Chestnut | Mature    | <b>Fair</b><br>Dominant canopy.<br>Slightly sparse upper canopy.<br>Major (more than 100mm diameter) and minor deadwood (less than 25mm diameter) throughout canopy.<br>Series of overlong branches standing outside main canopy.<br>Nylon cable bracing at c8m with metal cable bracing at c6m.<br>Three large stems from 2m, good unions<br>Previous pruning wound at 2.1m just above unions. | Replace nylon cable bracing system due to anticipated sunlight deterioration.<br><br>Clear telegraph pole by 2m.                                                                                                                                                          | Moderate<br><br>Low      |
| T37 | Ash            | Mature    | <b>Fair</b><br>Intermediate canopy.<br>Slightly sparse foliage in upper canopy.<br>Large branch grows towards and over Minden House.<br>Typical minor (less than 25mm diameter) and occasional moderate deadwood (25 – 100mm diameter) throughout.                                                                                                                                              | Remove deadwood more than 25mm diameter.<br><br>Reduce branch towards Minden House to radial length of 6m.                                                                                                                                                                | Moderate<br><br>Moderate |

| No  | Species        | Age class | Condition<br>(Physiological and structural)                                                                                         | Recommendations                                                                                                                                                                                                                                                                                        | Priority for works        |
|-----|----------------|-----------|-------------------------------------------------------------------------------------------------------------------------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------------------|
| T38 | Lime           | Mature    | <b>Good</b><br>Intermediate canopy.<br>Low branches close to lamp.                                                                  | Clear lamp by 2m.<br><br>Crown lift to 4m all round.                                                                                                                                                                                                                                                   | Low<br><br>Low            |
| T39 | Horse Chestnut | Mature    | <b>Removed</b>                                                                                                                      | Grind / remove stump.<br><br>Plant replacement tree (Tulip tree <i>Liriodendron tulipifera</i> or Sweet Chestnut <i>Castanea sativa</i> or Elm <i>Ulmus lutece</i> ).<br><br>Cut and remove turf within 0.5m radius of tree base to depth of 50mm and replace with wood chip to settled depth of 75mm. | Low<br><br>Low<br><br>Low |
| T40 | London Plane   | Young     | <b>Fair</b><br>Mechanical damage at base.                                                                                           | Cut turf and remove within 0.5m radius of tree base to depth of 50mm and replace with wood chip to settled depth of 75mm.                                                                                                                                                                              | Low                       |
| T41 | Sweet Chestnut | Young     | <b>Good</b><br>Dominant canopy.<br>Low branches over footway and adjacent to the carriageway.                                       | Cut turf and remove within 0.5m radius of tree base to depth of 50mm and replace with wood chip to settled depth of 75mm.<br><br>Crown lift to 3m all round and 5m over the carriageway to natural target pruning points.                                                                              | Low<br><br>Low            |
| T42 | London Plane   | Young     | <b>Fair</b><br>Sparse foliage.<br>Moderate mechanical damage at base.<br>Low branches over footway and adjacent to the carriageway. | Cut turf and remove within 0.5m radius of tree base to depth of 50mm and replace with wood chip to settled depth of 75mm.<br><br>Crown lift to 3m all round and 5m over the carriageway to natural target pruning points.                                                                              | Low<br><br>Low            |
| T43 | Sweet Chestnut | Young     | <b>Good</b><br>Low branches over footway and adjacent to the carriageway.                                                           | Cut turf and remove within 0.5m radius of tree base to depth of 50mm and replace with wood chip to settled depth of 75mm.<br><br>Crown lift to 3m all round and 5m over the carriageway to natural target pruning points.                                                                              | Low<br><br>Low            |

| No                                                                                                                                                              | Species        | Age class | Condition<br>(Physiological and structural)                               | Recommendations                                                                                                                                                                                                           | Priority for works |
|-----------------------------------------------------------------------------------------------------------------------------------------------------------------|----------------|-----------|---------------------------------------------------------------------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|--------------------|
| T44                                                                                                                                                             | Sweet Chestnut | Young     | <b>Good</b><br>Low branches over footway and adjacent to the carriageway. | Cut turf and remove within 0.5m radius of tree base to depth of 50mm and replace with wood chip to settled depth of 75mm.<br><br>Crown lift to 3m all round and 5m over the carriageway to natural target pruning points. | Low<br><br>Low     |
| <b>General maintenance works:</b><br>Crown lift all trees to 3m on an annual basis to natural target pruning points and maximum pruning wound diameter of 75mm. |                |           |                                                                           |                                                                                                                                                                                                                           |                    |
| <b>Resurvey: To be complete by 1<sup>st</sup> September 2022.</b>                                                                                               |                |           |                                                                           |                                                                                                                                                                                                                           |                    |

## General notes

The tree survey has been carried out in relation to the landowner's duty under the Occupier's Liability Act 1984 and common law. The tree survey was carried out from ground level, identifying significant tree features that may have significant bearing upon the condition and management of the tree and giving appropriate recommendations and priorities. All dimensions are estimated. No soil investigations will be carried out.

To carry out the tree survey reasonable access around the base of the tree is required. Where this is not feasible, these parts of the tree may not be able to be inspected. If view of the entire structure of the tree(s) is limited, for instance by the properties in private ownership, this is a limitation to the tree survey and some parts of the tree may not be able to be fully surveyed. The tree survey will be carried out from the ground with the aid of binoculars if necessary. The tree will not be climbed as part of this survey.

Typical significant defects that are to be identified can be referred to in "Hazards from Trees, a general guide" by David Lonsdale and "The body language of trees" by Claus Mattheck published by the Forestry Commission and the Department of the Environment respectively.

The tree survey can only be an assessment of the tree at the time of the survey and the tree(s) should be re-surveyed on a regular basis. An appropriate time period between surveys may be up to 5 years depending upon the condition of the trees, their maturity and the target(s). Recommendations for the period between surveys will be given.

As trees are dynamic structures their condition and health may change in a short period of time, particularly in relation to changes in their immediate environment and circumstances. Therefore, the survey is an assessment of the trees at the time of the survey only. If there is a significant change in the immediate environment and circumstances then this should be brought to the attention of the Arboriculturalist so that they may advise accordingly.

I have not checked whether the site is within a Conservation Area or whether the trees are under Tree Preservation Order (TPO). Prior to any tree works confirmation of whether these legal restrictions apply to the site or trees ought to be sought from the Local Planning Authority (LPA). If the trees stand within a Conservation Area designated under the Town and Country Planning Act the LPA will normally require 6 weeks notice of intention to carry out any tree works as detailed in the survey. If the trees are under TPO then the LPA will normally require an application for any tree works. Some tree works are exempt, for instance if the trees are dead or dangerous, and certain works can be carried out without application. It is necessary to give the LPA at least five days notice prior to carrying out any of these tree works under these exemptions. This survey, with recommendations, can be used to support any such application or notice.

Wildlife issues are of significant concern to the general public. A balance has to be found between the protection of wildlife and the need for safety when managing trees. The Wildlife and Countryside Act (1980) and Countryside Rights of Way Act (2000) give statutory protection to wild birds, bats, mammals, some invertebrates and plants. It is important to ensure that this legislation is properly considered when carrying out any works to trees.

Bird nests were not identified whilst on site. However, any Arborist carrying out the tree works should ensure that there is no disturbance to nesting birds prior to the works being carried out. Further guidance upon the appropriate timing of the works can be sought from DEFRA, if necessary. Where nesting birds are found, further information should be sought from DEFRA 08459 33 55 77 or [helpline@defra.gsi.gov.uk](mailto:helpline@defra.gsi.gov.uk). Prior to any works being implemented the tree contractor must identify whether there are any bats or birds using the tree as roost or nest. If such habitation is identified, then the tree contractor must obtain the necessary licence from Natural England (0845 601 4523 [www.naturalengland.org.uk](http://www.naturalengland.org.uk)) to carry out the works.

A bat survey prior to tree works is not recommended, except where there is a high potential for habitat. During the tree works, the contractor should carry out the tree works with bats as an active consideration and follow the current industry best practice, e.g. Arboricultural Association Guidance Note 1 Bats in the context of tree work operations 2011, BS8596 Micro guide to surveying for bats in trees and woodland <https://shop.bsigroup.com/upload/273444/BSI-Bat-Microguide-UK-EN.pdf> which a competent tree contractor should be familiar with.


Biosecurity measures: To minimise the potential for contamination of the tree from other tree works it is appropriate to sterilise tools to be used before and after the works are implemented. Appropriate disinfectant includes Propellar or Cleankill Sanitizing spray. Loose debris is to be brushed off prior to treating with disinfectant to ensure appropriate application. See [http://www.forestry.gov.uk/pdf/FCMS028-guidance.pdf/\\$file/FCMS028-guidance.pdf](http://www.forestry.gov.uk/pdf/FCMS028-guidance.pdf/$file/FCMS028-guidance.pdf) for further information on Biosecurity and <http://www.forestry.gov.uk/forestry/inf-d-9fjd2d> for disinfectant information.

## Key to condition survey sheet

|                                                    |                    |                                                                                                                                                                                                                                                                                                                                                                                                                           |
|----------------------------------------------------|--------------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| <b>No</b>                                          |                    | Tree number.                                                                                                                                                                                                                                                                                                                                                                                                              |
| <b>Species</b>                                     |                    | Species of tree.                                                                                                                                                                                                                                                                                                                                                                                                          |
| <b>Height</b>                                      |                    | Height measured in metres.                                                                                                                                                                                                                                                                                                                                                                                                |
| <b>Branch Spread</b>                               |                    | Branch spread in metres taken at the four cardinal points to derive an accurate representation of the crown.                                                                                                                                                                                                                                                                                                              |
| <b>Height of crown</b>                             |                    | Height in metres of crown clearance above adjacent ground level.                                                                                                                                                                                                                                                                                                                                                          |
| <b>Age Class (Age)</b>                             | <b>Young</b>       | A tree considered to be less than approximately 20 years old.                                                                                                                                                                                                                                                                                                                                                             |
|                                                    | <b>Middle aged</b> | A tree in approximately the first 1/5th of its normal life span with apical dominance (rapidly growing with a clear main leader) and not yet fully at its environmental potential full height.                                                                                                                                                                                                                            |
|                                                    | <b>Mature</b>      | A tree in its 2/5ths to 5/5ths of its normal life span with apical dominance lost and at its environmental potential full height.                                                                                                                                                                                                                                                                                         |
| <b>Condition</b><br>(Physiological and Structural) | <b>Good</b>        | Full healthy canopy; but possibly including some suppressed branches or minor physical damage. A tree that requires little or no tree works and it is anticipated to be retained for over 20 years.                                                                                                                                                                                                                       |
|                                                    | <b>Fair</b>        | Slightly reduced leaf cover, minor dead wood, or isolated major deadwood. A tree that requires tree works to remove defects and/or improve the form so that it may be anticipated to be retained for over 5 years.                                                                                                                                                                                                        |
|                                                    | <b>Poor</b>        | Overall sparse leafing or extensive dead wood. A tree that has a significant proportion of defects and/or requires considerable tree works to aid its retention and/or where the retention of the tree is not anticipated beyond 5 years.                                                                                                                                                                                 |
|                                                    | <b>Very poor</b>   | Large areas of crown dead. A tree that has a significant proportion of defects and/or requires considerable tree works to aid its retention.                                                                                                                                                                                                                                                                              |
| <b>Recommendations</b>                             |                    | As per BS3998: 2010 Recommendations for Tree Works.                                                                                                                                                                                                                                                                                                                                                                       |
| <b>Priority</b>                                    | <b>Immediate</b>   | Works should be carried out immediately as the probability of harm or damage occurring is likely.                                                                                                                                                                                                                                                                                                                         |
|                                                    | <b>High</b>        | These works are important to carry out as soon as reasonably possible and any budget available for tree management should be spent upon these trees before the moderate and low categories. Works in this category usually will relate to abatement of risk for harm and or damage to occur. Ideally works in this category are anticipated to be carried out within 1 month.                                             |
|                                                    | <b>Moderate</b>    | These works are important to carry out as soon as reasonably possible and any budget available for tree management should be spent upon these trees before the low categories. Works in this category usually will relate to abatement of risk for harm and or damage to occur and for the good arboricultural management of the trees. Ideally works in this category are anticipated to be carried out within 3 months. |
|                                                    | <b>Low</b>         | Works in this category usually will relate to the good arboricultural management of the trees. Ideally works in this category are anticipated to be carried out within 12 months.                                                                                                                                                                                                                                         |
| <b>Re-survey</b>                                   |                    | This is the time period in which it is recommended that the tree is surveyed again. This is based upon the condition of the tree, its location, previous, current and future management. It is normally expressed at a time period from the date of the report / survey, which ever is the sooner. If no time period is noted, then the default period is one year.                                                       |

## Site plan



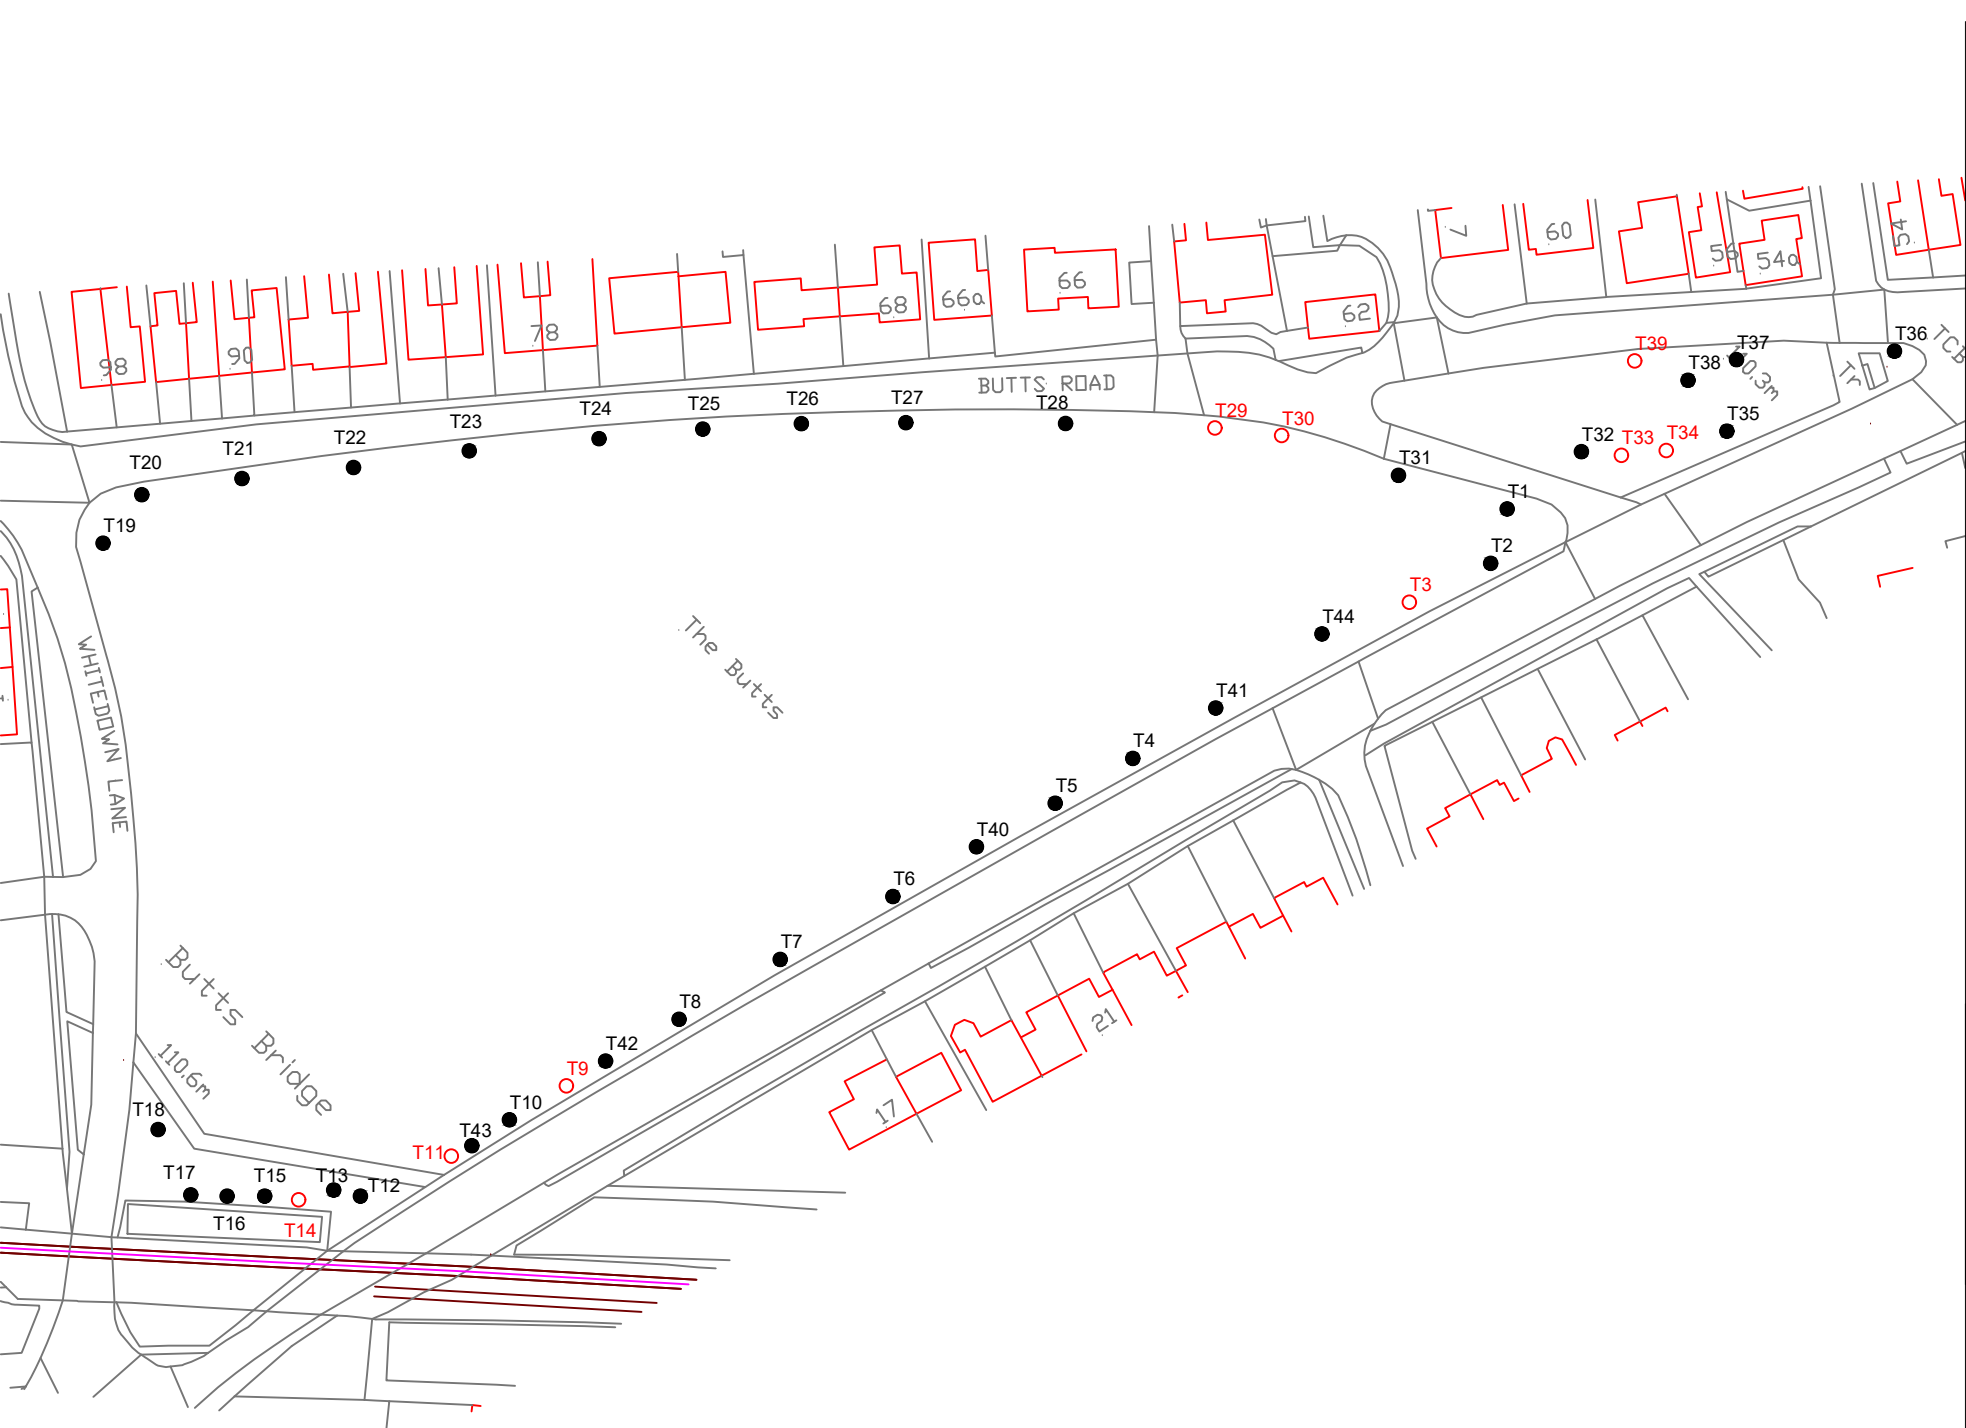

**General / Key:**

- Tree position ●
- Tree position (removed) ○

**Client:**  
Alton Town Council

**Site:**  
The Butts public open space

**Data:**  
OS data provided by  
Centremapslive under licence  
10001998 with Crown copyright

This drawing is copyright of Sapling  
Arboriculture Limited and may not be copied,  
altered or reproduced in any way without  
written authority from Sapling Arboriculture  
Limited.

**Drawing title:**  
Tree condition survey

**Drawing reference:**  
J064.16.01

**Revision:**  
-

**Date:**  
March 2020

**Scale:**  
Do not scale from this drawing.

**Sheet:**  
1 of 1

sapling  
arboriculture ltd

registered in england: 5414238

T: 01420 544 860  
E: ben@saplingarboriculture.com  
W: www.saplingarboriculture.com

**Ben Abbatt**  
MIFor, MRICS, CEm, Dip. Arb. (RFS), BA (Hons)  
Arboricultural Association Registered Consultant

**Notes:**

Positions of trees and groups have been located approximately and their exact position is not accurately shown by this drawing. The position of the trees and groups on this drawing is an indication only. For the correct position of the trees then please refer to the land survey data.



© 2020

This document was written by, belongs to and is copyright to Sapling Arboriculture Limited. It contains valuable Sapling Arboriculture Limited proprietary and confidential information which is disclosed only for the purposes of the client's assessment and evaluation of the project which is the subject of this report. The contents of this document shall not, in whole or in part (i) be used for any other purposes except such assessment and evaluation of the project; (ii) be relied upon in any way by the person other than the client (iii) be disclosed to any member of the client's organisation who is not required to know such information nor to any third party individual or organisation, or (iv) be copied or stored in any retrieval system nor otherwise be reproduced or transmitted in any form by photocopying or any optical, electronic, mechanical or other means, without prior written consent of the Company Secretary Director, Sapling Arboriculture Limited, to whom all requests should be sent. Accordingly, no responsibility or liability is accepted by Sapling Arboriculture Limited towards any other person in respect of the use of this document or reliance on the information contained within it, except as may be designated by law for any matter outside the scope of this document.