

Tree Survey Report

Site Address

Anstey Park
London Road
Alton
GU34 2RN

Report No.

G&TS/SR/0347

Site Surveyed by

Steven Lamb

Report Prepared by


Simon Rogers

Approved by

Stuart Campbell FdSc (Arb) MArborA

Date

6th July 2026

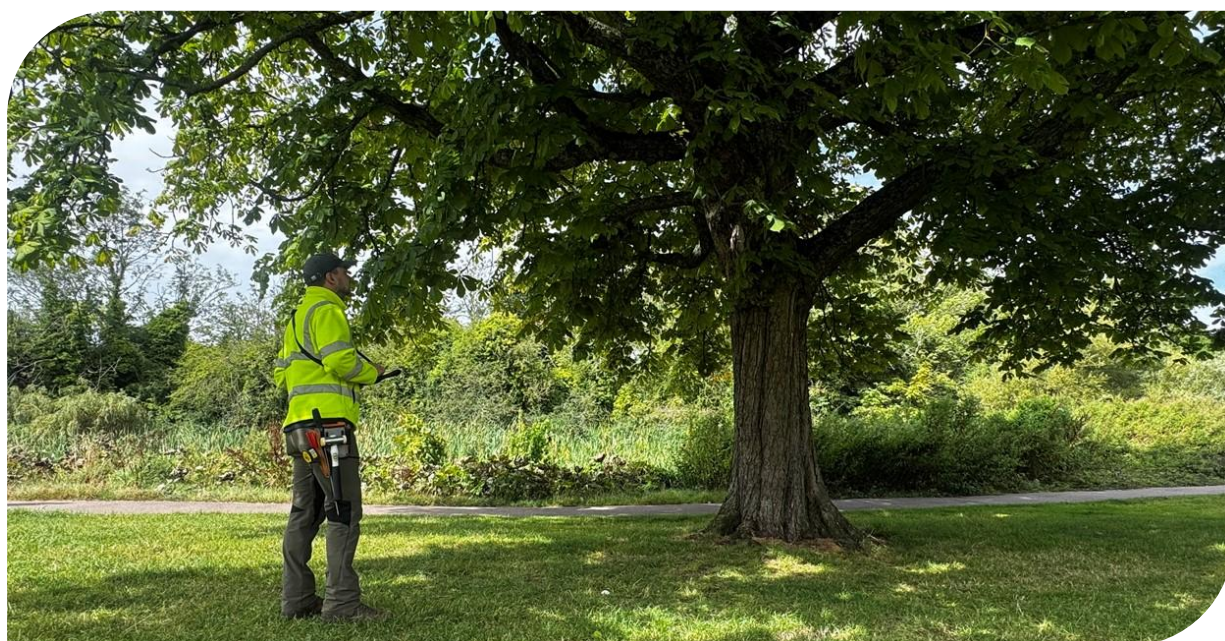

Contents

1. Introduction	3
1.1 Assignment	3
1.2 Documents and Information Provided	3
1.3 Scope of This Report	3
1.4 Limitations of Use	3
2. Site Visit Observations	3
3. Identification and Location of Trees	3
4. Observations	4
5. Works Priority	4
6. Recommendations	5
7. Future Considerations	6
8. Other Considerations	6
8.1 Trees subject to statutory controls	6
9. Reference Material	6
10. Survey Certification	7
11. Appendix 1: Glossary of Arboricultural Terminology	8
12. Appendices 2 & 3:	13
• Tree Schedule – Priority Works	13
• Tree Location Plan	13



1. Introduction

1.1 Assignment

Gristwood & Toms (a Nurture Group Company) has been instructed by Alton Town Council to carry out a survey of the trees within the grounds of **Anstey Park, London Road, Alton, GU34 2RN**. Where appropriate, we are to make recommendations on the immediate and future management in the interest of safety.

1.2 Documents and Information Provided

No documents or information was provided

1.3 Scope of This Report

This report solely relates to the trees that Steven Lamb surveyed on 13th, 14th and 15th May 2026.

1.4 Limitations of Use

The content and format of this report are for the exclusive use of the addressee in dealing with this site. It may not be sold, lent, hired out or divulged to any third party not directly involved in this site without the written consent of Gristwood & Toms.

2. Site Visit Observations

An unaccompanied site visit of Anstey Park, London Road, Alton, GU34 2RN was carried out by Steven Lamb on 13th, 14th and 15th May 2026. The trees were inspected using the Visual Tree Assessment (VTA) methodology described by Claus Mattheck and Helge Breloer in *The Body Language of Trees* (1994). Stationery Office Books (TSO) and endorsed by the Arboricultural Association (LANTRA Professional Tree Inspection course, 2007).

All observations were from ground level without detailed investigations. All dimensions were estimated unless otherwise indicated. The weather at the time of the survey was warm and sunny with good visibility.

3. Identification and Location of Trees

The survey schedule lists the species, based on visual observation, giving the scientific and common names of the tree. The tree survey schedule is included in the appendices of this report.



4. Observations

There were **144 features** in total inspected on the site. Of the 144 features inspected, **143 features** were identified as individual trees, and **1 feature** was identified as a hedgerow.

Of the **143 individual trees** inspected on the site, **2 trees** were identified to be in a good condition. **136 trees** were identified to be in a fair condition. **4 trees** were identified to be in a poor condition. **1 tree** was identified to be dead.

Of the **1 hedgerow** inspected on the site, **1 hedgerow** was identified to be in a fair condition.

5. Works Priority

Urgent – Public Safety

Works are urgently required to make safe a tree that has been identified as dead/structurally unsound and is putting public safety at risk.

These works are recommended to be completed within **1 month**.

High Priority

Works may be required for the following reasons:

To keep the highways infrastructure (e.g., streetlights and road signs) clear of obstructions and maintain sight lines for vehicles or pedestrians.

To abate an actionable nuisance (e.g., branches damaging windows and gutters).

When an inspection has identified visible decay, fungal brackets, or other structural defects.

To reduce a significant overhang of tree branches into an adjacent property.

When previous maintenance regimes have determined that future works are of the same specification for that specimen (e.g., pollarding and crown reduction).

These works are recommended to be completed within **12 months**.

Low Priority

Works may be carried out on a cyclic pruning regime to provide long term health and safety benefits to the tree.

These works are recommended to be completed within **24 months**.

No Action Required

Where a tree's health and condition indicate no works are required at the time of inspection.

The presence of any defect will increase the chances of failure. Each species has its own profile of defects. Some factors that must be considered include the species growth habit, tree



condition, branch attachments, resistance to decay, condition of anchoring roots, cultural or maintenance history and previous damage.

Failure Potential	Urgent – Public Safety	High Priority	Low Priority	No Action Required
Works Within 1 Month	0			
Works Within 12 Months		72		
Works Within 24 Months			24	
No Action Required				48

6. Recommendations

Recommendations have been made for tree works in line with sound Arboricultural management and it is recommended that the works are undertaken within the suggested timescales.

There are **0 trees, or hedgerows** identified that require **Urgent – Public Safety** tree work. It is recommended that the works should be completed within the next **1 month**.

There are **72 trees** identified that require **High Priority** tree work. It is recommended that the works should be completed within the next **12 months**.

There are **24 trees** identified that require **Low Priority** tree work. It is recommended that the works should be completed within the next **24 months**.

There are **48 trees** identified as **No Action Required**.

All recommended tree works are to be carried out in accordance with BS 3998:2010 – Tree Work Recommendations.

Nesting Birds: Any recommended tree works should be undertaken outside the bird nesting season (1st March to 31st August); however, it should be assumed that birds will nest before and after this period. A wildlife assessment should be carried out immediately prior to the commencement of works. This will inform on whether there are nesting birds and if works on a specific tree can proceed without harming any birds.

Bats: Prior to commencing aerial works or felling, the arborists should carry out a visual assessment for the potential for bat habitation. If there is a possibility of bats using a tree for roosting, the Commissioning Officer (Agent) should be contacted and works to the tree suspended until an ecologist has visited the site to provide advice on whether works can proceed without any risk of harm to bats.



7. Future Considerations

Trees are living organisms whose health and condition can change rapidly; therefore, the health, condition and safety of trees should be checked on a regular basis.

When the recommended tree work has been carried out, it is suggested that an inspection regime is introduced so that the subject trees are inspected on a **24-monthly cycle**, unless otherwise indicated within Appendix 2: Tree Schedule – Priority Works of this report.

8. Other Considerations

8.1 Trees subject to statutory controls

If any trees are covered by a Tree Preservation Order or located in a conservation area it will be necessary to consult the local authority before any tree work can be carried out. The works specified above are necessary for reasonable management and should be acceptable to the local authority.

9. Reference Material

Wilson, P. (n.d.). *Tree Terms - Arboricultural definitions*. [online] A-Z of tree terms: A companion to British arboriculture. Available at: <http://www.treeterms.co.uk/>.

Johnson, O. and More, D. (2006). *Collins tree guide*. London: Collins.

C Mattheck (2007). *Updated field guide for visual tree assessment*. Karlsruhe: Forschungszentrum Karlsruhe.

Claus Mattheck, Helge Breloer and Britain., G. (1994). *The Body Language of Trees*. Stationery Office Books (TSO).

Lonsdale, D. (1999). *Principles of Tree Hazard Assessment and Management*. Stationery Office Books (TSO).

Strouts, R.G., Winter, T.G. and Great Britain. Forestry Commission (2004). *Diagnosis of ill-health in trees*. Norwich: TSO.

Guy, W. (2014). *Tree pests and diseases: an arborists' field guide*. Stonehouse, Gloucestershire: Arboricultural Association.

Watson, G., Green, T. and Arboricultural Association (2011). *Fungi on trees: an arborists' field guide*. Stonehouse, Gloucestershire: Arboricultural Association, Cop.

British Standards Institution (2010). *BS 3998:2010 Tree Work – Recommendations*. London: BSI.



10. Survey Certification

Site Surveyed By:

Steve Lamb

Report Completed By:

Simon Rogers

Report Approved By:

Stuart Campbell FdSc (Arb) MArborA.

Date:

6th July 2026



11. Appendix 1: Glossary of Arboricultural Terminology

Ash Dieback	Ash dieback is a disease that affects ash trees (<i>Fraxinus spp.</i>), caused by a fungus called <i>Hymenoscyphus fraxineus</i> . The fungus blocks water transportation within the tree, leading to bark lesions, leaf loss and dieback of the crown.
Asymmetrical Crown	Unbalanced crown often resulting from storm damage, uneven pruning work or the proximity of neighbouring trees.
Bark exudate	A flow of viscous liquid (bleeding from bark) exuded onto the surface of the bark from the underlying tissues consisting of largely of <i>gum</i> , <i>resin kino</i> or <i>latex</i> depending on the species of tree. Bark exudate indicates the inner bark is dead, dying, or injured owing to disease, physical injury, root damage etc.
Branch Stub	That part of a decapitated or broken branch protruding beyond the branch collar, sometimes called a snag. It is considered not good pruning practice to leave stubs. Branch stubs may give rise to unwanted epicormic shoots or may lack vigour and subsequently die back, making them prone to decay.
Brown rot	Form of decay where cellulose is degraded, while lignin is only modified.
Buttress root	Roots that emerge from the base of the tree stem, normally large and well developed and rapidly forming the connection between the stem and the transport roots.
Cambium	A thin layer of actively growing and dividing cells, located between the xylem (sapwood) and the bark of a plant, the part responsible for radial growth of a tree stem or branch.
Canker	A localised area of dead bark and cambium on a stem or branch, caused by fungal or bacterial organisms, characterised by wound wood development on the periphery. This may be annual or perennial.
Co-dominant stem/ trunk	Forked branches or trunks of nearly the same size in diameter and lacking a normal branch union.
Compartmentalisation	The physiological process that creates the chemical and mechanical boundaries that act to limit the spread of disease and decay organisms.
Conservation area	Designated areas of architectural or historical interest, in which there are special procedures for planning applications. Additionally, tree works cannot generally, be undertaken without prior notification to the relevant local planning authority.



Crown lifting	Crown lift the removal of the lowest branches, usually to a given height. It allows more residual light and greater clearance underneath for vehicles etc.
Crown reduction	The reduction of a tree's height or spread while preserving the tree's natural shape.
Crown thinning	The removal of some of the density of a tree's crown, usually 5-25% allowing more light through its canopy and reducing wind resistance.
Deadwood	Deadwood is often present within the crown or on the stems of trees. It may be an indication of ill health; however, it may also indicate growth processes. If a target beneath the tree, deadwood may fall and cause injury or damage and should be removed, otherwise deadwood can remain intact for conservation purposes (insects, fungi, birds etc), also, the removal of dead branches from a tree's canopy, usually of a specified size (in diameter).
Decay	Progressive deterioration of organic tissues, usually caused by fungal or bacterial organisms, resulting in loss of cell structure, strength, and function. In wood, the loss of structural strength.
Epicormic growth	Fast growing, weakly attached shoots/branches that often grow as a response to stress factors upon a tree or branch removal.
Formative pruning	The trimming of a tree to remove weaknesses and irregularities which may lead to problems. The formative pruning operation is aimed at reducing the potential for future weaknesses or problems within the tree's crown.
Girdling Root	In woody plants, a root that grows across the buttress, or across other roots, eventually causing constriction of the radial growth.
Hazard Beam	An upwardly curved branch in which strong internal stresses may occur without the compensatory formation of extra wood (longitudinal splitting may occur in some cases).
Horse Chestnut Bleeding Canker	Formally attributed to <i>Phytophthora</i> spp. thought to be responsible for 5-10% of cases but following an upsurge of the disease it is now mostly attributed to the bacterium ' <i>Pseudomonas syringae</i> pv. <i>Aesculi</i> '. Horse Chestnut Bleeding Canker kills the bark, resulting in conspicuous bleeding that dries into a black bark exudate. Branches and trees, including young trees, can be completely girdled resulting in the death of the tree.
Included Bark	Bark that becomes embedded in a crotch between branch and trunk or between co-dominant stems, found in narrow or tight crotches, and causes a weak structure.
Massaria	<i>Massaria</i> (<i>Splanchnonema platani</i>) is a disease of London Plane (<i>Platanus x hispanica</i> , also known as <i>Platanus x acerifolia</i>) which causes large lesions on the upper surfaces of major branches and branch dieback and can cause branches to break off the tree and fall.



Monolith	Retaining a standing stem for wildlife habitat or conservation purposes at any given height. The height a monolith is left at is often determined by the proximity to any given target to be less than the falling distance to that target.
Oak Processionary Moth	A cause of defoliation, especially of oaks and trees of other species growing next to defoliated oaks. Eggs are laid within the outer crown of the host tree in late summer and hatch the following spring. The larvae feed on the leaves and often move head-to-tail in a procession, hence their common name. They make communal nests (sometimes called tents) out of silken thread in which they shelter when not feeding. Nests may be spun on the underside of a branch or on the trunk. The hairs of (later stage) larvae are a serious irritant and may provoke an allergic reaction. They easily break off, or are shed when the caterpillars are disturbed, to be dispersed in the air, as well as their abandoned nests, should be treated with extreme caution. Every year oaks in public places are surveyed for OPM and treated with insecticide. Private tree owners may be responsible for their own survey and control, potentially enforced by a plant health notice or the powers of the local authority.
Occluding tissue	The general term of wood, cambium and bark that develop around the site of a wound on a woody plant.
Phytophthora spp.	Phytophthora is a genus of water molds that cause devastating diseases in trees, affecting roots, stems, and foliage. Several species, like <i>Phytophthora ramorum</i> (which causes Ramorum disease), <i>Phytophthora lateralis</i> , and <i>Phytophthora kernoviae</i> , are known to be highly destructive. These pathogens can lead to root rot, stem cankers, dieback, and ultimately, death of the host tree.
Picus Tomography	PiCUS testing is a non-invasive method of determining the extent of decay in trees. The PiCUS Sonic Tomograph is an instrument that can detect decay in trees by taking readings of the velocity of soundwaves through the trunk/stem from several sensors, installed with small nails around the trunk, which are each struck to pass sound through the trunk/stem. These readings are used to create a tomogram, which shows the consistency of the wood within the tree and identifies area/s of decay.
Pollard/Re-Pollard	The complete or partial removal of the crown of a young tree so as to encourage the development of numerous branches either for amenity or historically as fodder, repeated management is required cyclically to maintain the feature.
Resistograph	The Resistograph equipment is a drill-based tool using a stainless-steel drill bit that is approx. 1/16 inch in diameter and about 20 inches in length and is used to establish the strength of wood, without the need for destructive testing. As the subject tree is drilled, sound wood being denser than decayed wood offers greater resistance to the drill bit as it passes through the wood. This resistance is recorded electronically across the radius of the section being tested. The depth of drilling is dependent on the drill length and dimension of the tree part



being tested. The measurement depth is recorded in centimetres while the amplitude (resistance) reading is given as a percentage across a range of 0 to 100%. The readings allow the Arboriculturalist to assess the internal condition of the subject tree.

Root collar	The basal area of the tree; transition zone from trunk to root. Also sometimes called trunk flare.
Scaffold limbs / scaffold branches	The branches that form the main network framework of the crown of a tree.
Sever ivy and re-inspect	Cut or sever a band of ivy from ground level to a defined height, usually 1.5m above ground level to allow for the inspection and reporting of the base of the tree. Severing ivy also allows the ivy above to die back over a period of time to facilitate future inspections.
Slime Flux	Relating to a toxic condition from the spreading of bacteria or their products from a source of infection: characterised by malodorous gases, or salt deposits upon the bark. Should these enter the sap stream, localised vessel necrosis can result.
Soft rot	A kind of wood decay, where a fungi degrades cellulose within the cell wall, without causing overall degradation.
Sooty Bark Disease	<i>Cryptostroma corticale</i> (Sooty bark disease) is a species of fungus that causes sooty bark disease of maples, particularly sycamore (<i>Acer pseudoplatanus</i>). The spores grow in large amounts under the bark of affected trees or stacked allergenic and cause a debilitating pneumonitis (inflammation of the lungs) in humans.
Stag-head/heading	The outer branches of a tree that have died and now tend to protrude beyond the present extent of the crown.
Subsidence	In relation to vegetation, the removal of water by plant growth resulting in localised shrinkage in the soil volume.
Suppressed	Trees which are dominated by surrounding vegetation and whose crown development is restricted from above.
Tight Union / Tight Crotch	A crotch with a narrow angle between branches, often having included bark.
Tree Preservation Order	An order made by the local planning authority, where consent must be gained before undertaking all but exempt works to a tree.
Visual Tree Assessment (VTA)	An assessment of the mechanical condition of trees based upon their 'body language'. Trees are dynamic and respond to faults / decay / environmental factors in various ways, these responses can be indicative of structural integrity.



Wetwood

An infection caused by bacteria living inside the plant tissues. The bacteria ferment the plant fluids, resulting in death of nearby cells, and often causing exudations of fluid from the bark, often referred to as a Slime Flux.

White Rot

A type of wood decay where fungi attacks the lignin within the wood matrix.



12. Appendices 2 & 3:

- Tree Schedule – Priority Works
- Tree Location Plan



Appendix 1: Tree Schedule



Feature Type / Tree Code	Tree Seq.no	Store code & name/Location	Tree Location within site	Geo-location Data			Site features	Tree species (Common Name)	No. of stems	Tree Dimensions			Tree defects	Condition	Recommendations	Priority	Date of inspection	Date of next inspection
				O/s Grid Reference	Latitude - Longitude	What3Words				Height (m) (Approx.)	Crown spread (m) (Approx.)	Stem diameter at breast height (cm) (measured)						
Hdg/862020	H1	Anstey Park, GU34 2RN	London Road boundary	472740-140418	51.1585552 - 0.9606268	sound.providing.highlighted	* Grass * Public access: high	Fagus spp. (Beech species)	1	2.0m	0.5m	2cm	* Typical of species and age	Fair	* No work required	No action required	13/05/2026	May 2028
Sgl/355800	1	Anstey Park, GU34 2RN	Adjacent car park	472563-140391	51.1581800 - 0.9637606	commended.conducted.pltchers	* Grass * Public access: high	Acer campestre (Field Maple)	1	7.0m	7.0m	29cm	* Decay - minor basal * Low branches * Typical of species and age	Fair	* Crown lift to 2.5 metres	Low Priority	13/05/2026	May 2028
Sgl/355804	2	Anstey Park, GU34 2RN	Adjacent car park	472563-140396	51.1582222 - 0.9637500	butternut.turns.upgrading	* Grass * Public access: high	Acer campestre (Field Maple)	1	7.0m	7.0m	35cm	* Low branches * Typical of species and age	Fair	* Crown lift to 2.5 metres	Low Priority	13/05/2026	May 2028
Sgl/355808	3	Anstey Park, GU34 2RN	Adjacent car park	472568-140396	51.1582276 - 0.9636809	project.shins.costumed	* Grass * Public access: high	Acer campestre (Field Maple)	1	6.5m	7.0m	34cm	* Low branches * Typical of species and age	Fair	* Crown lift to 2.5 metres	Low Priority	13/05/2026	May 2028
Sgl/355812	4	Anstey Park, GU34 2RN	Adjacent car park	472569-140391	51.1581748 - 0.9636717	redouble.drain.magpie	* Grass * Public access: high	Acer campestre (Field Maple)	1	7.0m	7.0m	32cm	* Low branches * Typical of species and age	Fair	* Crown lift to 2.5 metres	Low Priority	13/05/2026	May 2028
Sgl/355816	5	Anstey Park, GU34 2RN	Adjacent car park	472574-140380	51.1580815 - 0.9636091	towel.boaf.waxes	* Grass * Public access: high	Malus spp. (Apple species)	1	8.0m	12.0m	76cm	* Audible sounds of decay detected - Possible decay ingress via crotch pockets * Cracked & lifting bark - Around main stem * Die back whole crown - Dieback spread since last inspection * Major dead wood >50mm	Poor	* Fell to ground level and remove all arisings * Grind stump 300mm single stump	High Priority	13/05/2026	May 2028
Sgl/355824	7	Anstey Park, GU34 2RN	Adjacent car park	472579-140393	51.1581949 - 0.9635263	honeybees.division.singing	* Grass * Public access: high	Tilia x europaea (Common Lime)	1	6.0m	6.0m	26cm	* Typical of species and age	Fair	* No work required	No action required	13/05/2026	May 2028
Sgl/355832	9	Anstey Park, GU34 2RN	South side of access road from Anstey Rd	472600-140374	51.1580205 - 0.9632248	juggles.stems.hike	* Grass * Public access: high	Sorbus spp. (Rowan/Whitebeam fam.)	1	3.0m	1.0m	10cm	* Broken/Vast leader	Poor	* No work required	No action required	13/05/2026	May 2028
Sgl/355836	10	Anstey Park, GU34 2RN	South side of access road from Anstey Rd	472601-140365	51.1579387 - 0.9632143	noted.committee.budding	* Grass * Public access: high	Liquidambar styraciflua (Sweet Gum)	1	9.0m	10.0m	35cm	* Low branches * Typical of species and age	Fair	* Crown lift to 2.5 metres	Low Priority	13/05/2026	May 2028
Sgl/355844	12	Anstey Park, GU34 2RN	Adjacent Anstey Park House	472623-140350	51.1578036 - 0.9629006	shield.coverage.treaty	* Grass * Public access: high	Quercus robur 'Fastigiata' (Fastigate Oak)	1	8.0m	10.0m	38cm	* Typical of species and age	Fair	* No work required	No action required	13/05/2026	May 2028
Sgl/355848	13	Anstey Park, GU34 2RN	Adjacent Anstey Park House	472618-140337	51.1576906 - 0.9629755	chew.teardrop.butchers	* Grass * Public access: high	Cotoneaster spp. (Cotoneaster species)	3	5.5m	12.0m	35cm	* Cracked & lifting bark - Southern stem * Multi-stemmed * Typical of species and age	Fair	* Basal/Epicormic growth removal	Low Priority	13/05/2026	May 2028
Sgl/355852	14	Anstey Park, GU34 2RN	Adjacent Anstey Park House	472607-140324	51.1575746 - 0.9631379	valid.tragedy.passively	* Grass * Public access: high	Cotoneaster spp. (Cotoneaster species)	4	5.0m	12.0m	30cm	* Bark wound over 20% of stem - Occluding * Decay - minor basal * Low branches * Multi-stemmed * Codominant stems	Fair	* Basal/Epicormic growth removal * Crown lift to 3 metres - Lift 2m	High Priority	13/05/2026	May 2028
Sgl/355856	15	Anstey Park, GU34 2RN	Adjacent Anstey Skate Park	472594-140308	51.1574325 - 0.9633314	knee.baffle.gladiator	* Grass * Public access: high	Carpinus betulus (Hornbeam)	1	4.5m	5.5m	16cm	* Decay - minor basal - Stemmer damage * Low branches * Typical of species and age	Fair	* Crown lift to 2.5 metres	Low Priority	13/05/2026	May 2028
Sgl/355860	16	Anstey Park, GU34 2RN	Adjacent Anstey Skate Park	472590-140304	51.1573940 - 0.9633837	endings.directly.eamarked	* Grass * Public access: high	Carpinus betulus (Hornbeam)	1	6.0m	8.0m	30cm	* Low branches * Typical of species and age	Fair	* Crown lift to 2.5 metres	Low Priority	13/05/2026	May 2028
Sgl/355864	17	Anstey Park, GU34 2RN	Adjacent Anstey Skate Park	472595-140304	51.1573917 - 0.9633130	underline.wordplay.credible	* Grass * Public access: high	Carpinus betulus (Hornbeam)	1	6.0m	8.0m	27cm	* Decay - minor/basal * Low branches * Typical of species and age	Fair	* Crown lift to 2.5 metres	Low Priority	13/05/2026	May 2028
Sgl/355876	20	Anstey Park, GU34 2RN	Adjacent Anstey Skate Park	472628-140283	51.1572038 - 0.9628546	digests.yawned.seemingly	* Grass * Public access: high	Amelanchier spp. (Snowy Mespil)	1	5.5m	6.0m	35cm	* Die back isolated * Minor dead wood <50mm * Narrow forks with included bark * Codominant stems	Poor	* No work required	No action required	13/05/2026	May 2028
Sgl/355880	21	Anstey Park, GU34 2RN	Adjacent Anstey Skate Park	472631-140269	51.1570700 - 0.9628105	relocated.chain.harnessed	* Grass * Public access: high	Aesculus hippocastanum (Horse Chestnut)	1	10.0m	10.0m	60cm	* Minor dead wood <50mm * Main Stem/Trunk - Other considerations - Bacterial slime exude from narrow union, approximately 2m above ground level. 15cm diameter area of raised bark adjacent exudation * Narrow forks with included bark	Fair	* Reduce and reshape crown by 1.5m - Reduce crown height by 2m and spread by 1.5m	High Priority	13/05/2026	May 2028
Sgl/355884	22	Anstey Park, GU34 2RN	Adjacent Anstey Skate Park	472583-140279	51.1571739 - 0.9635003	unearthly.elections.upgrading	* Grass * Public access: high	Tilia x europaea (Common Lime)	1	22.0m	12.0m	100cm	* Dense crown * Epicormic growth in crown - Restricting via * Minor dead wood <50mm * Raised roots/bulbressing	Fair	* Basal/Epicormic growth removal	High Priority	13/05/2026	May 2028
Sgl/355892	24	Anstey Park, GU34 2RN	Adjacent tennis courts	472553-140268	51.1570733 - 0.9639241	noddad.detective.drove	* Grass * Public access: high	Aesculus hippocastanum (Horse Chestnut)	1	17.0m	12.0m	90cm	* Cavity * Cracked & lifting bark * Historic pruning wounds * Minor dead wood <50mm * Typical of species and age	Fair	* Picus/Resistograph Test Required - Investigate extent of basal decay	High Priority	13/05/2026	May 2028
Sgl/355896	25	Anstey Park, GU34 2RN	Adj Anstey Lane, opposite Westone House	472506-140280	51.1571846 - 0.9645920	breathing.tailwind.instructs	* Grass * Public access: high	Quercus rubra (Red Oak)	1	5.5m	4.0m	16cm	* Low branches * Typical of species and age	Fair	* Crown lift to 2.5 metres	Low Priority	13/05/2026	May 2028
Sgl/355900	26	Anstey Park, GU34 2RN	Adjacent Anstey Lane junction	472586-140214	51.1565863 - 0.9634629	hotspot.proclaims.daring	* Grass * Public access: high	Aesculus hippocastanum (Horse Chestnut)	1	10.0m	12.0m	52cm	* Low branches	Fair	* Crown lift to 3 metres - Lift 2.5m and 6m over road * Crown lift to 6 metres	High Priority	13/05/2026	May 2028
Sgl/355908	28	Anstey Park, GU34 2RN	Between tennis courts and football pitch	472497-140305	51.1574168 - 0.9647116	budgeted.spilled.subjects	* Grass * Public access: high	Fagus sylvatica (Common Beech)	1	7.5m	7.5m	31cm	* Low branches * Typical of species and age	Fair	* Crown lift to 2.5 metres	Low Priority	13/05/2026	May 2028
Sgl/355912	29	Anstey Park, GU34 2RN	Between tennis courts and football pitch	472497-140314	51.1574925 - 0.9647168	seaside.upholding.dates	* Grass * Public access: high	Fagus sylvatica (Common Beech)	1	8.5m	8.0m	39cm	* Low branches * Typical of species and age	Fair	* Crown lift to 2.5 metres	Low Priority	13/05/2026	May 2028
Sgl/355916	30	Anstey Park, GU34 2RN	Adjacent Anstey Lane	472489-140294	51.1573168 - 0.9648307	enthused.maps.udder	* Grass * Public access: high	Quercus spp. (Oak species)	1	4.0m	2.0m	9cm	* Staked tree * Typical of species and age	Fair	* Young tree maintenance - Remove stakes	High Priority	13/05/2026	May 2028
Sgl/355920	31	Anstey Park, GU34 2RN	Adjacent Anstey Lane	472480-140305	51.1574201 - 0.9649672	potential.supply.rentals	* Grass * Public access: high	Quercus spp. (Oak species)	1	5.0m	5.5m	22cm	* Typical of species and age	Fair	* No work required	No action required	13/05/2026	May 2028
Sgl/355928	33	Anstey Park, GU34 2RN	Between tennis courts and football pitch	472531-140346	51.1577757 - 0.9642226	situates.foods.condense	* Grass * Public access: high	Tilia x europaea (Common Lime)	1	12.0m	6.0m	75cm	* Historic pruning wounds * Major dead wood >50mm * Evidence of recent major surgery	Fair	* Basal/Epicormic growth removal * Remove dead and diseased wood	High Priority	13/05/2026	May 2028

Sgl/355932	34	Anstey Park, GU34 2RN	Between tennis courts and football pitch	472532-140343	51.1577537 - 0.9642083	vars.instance.origin	* Grass * Public access: high	Acer pseudoplatanus (Sycamore)	1	9.0m	5.0m	88cm	* Decay in historic pruning wound * Historic pruning wounds * Minor dead wood <50mm * Main stem rot * Evidence of recent major surgery * Regrown pollard or topped tree	Poor	* Basal/Epicomic growth removal * Reduce crown by 50% - Decaying stem not stable enough to support large crown	High Priority	13/05/2026	May 2028
Sgl/355936	35	Anstey Park, GU34 2RN	Between tennis courts and football pitch	472534-140344	51.1577600 - 0.9641767	gossiped.starter.vaccines	* Grass * Public access: high	Acer pseudoplatanus (Sycamore)	1	15.0m	10.0m	100cm	* Asymmetrical crown * Bark wound on trunk (Minor) * Die back isolated * Historic pruning wounds * Major dead wood >50mm * Minor dead wood <50mm	Fair	* Basal/Epicomic growth removal * Remove dead and diseased wood	High Priority	13/05/2026	May 2028
Sgl/355940	36	Anstey Park, GU34 2RN	Between tennis courts and football pitch	472536-140346	51.1577780 - 0.9641589	tenure.lies.homework	* Grass * Public access: high	Tilia x europaea (Common Lime)	1	18.0m	12.0m	125cm	* Basal and trunk suckers - Restricting vta * Historic pruning wounds * Major dead wood >50mm * Minor dead wood <50mm	Fair	* Basal/Epicomic growth removal * Remove dead and diseased wood	High Priority	13/05/2026	May 2028
Sgl/355944	37	Anstey Park, GU34 2RN	Adjacent Anstey Lane	472469-140316	51.1575164 - 0.9651117	mountain.yard.financial	* Grass * Public access: high	Prunus spp. (Cherry species)	1	2.0m	0.9m	7cm	* Staked tree - Replanted	Fair	* No work required	No action required	14/05/2026	May 2028
Sgl/355948	38	Anstey Park, GU34 2RN	Adjacent Anstey Lane	472461-140324	51.1575942 - 0.9652356	intrigues.diary.bounding	* Grass * Public access: high	Sorbus torminalis (Wild Service Tree)	1	8.0m	6.0m	46cm	* Crossing branches * Cracked & lifting bark * Damaged branches * Decay - major basal * Main stem rot - Exuding adjacent to bark damage	Fair	* Reduce and reshape crown by 1.5m - Reduce crown and clear fallen limb	High Priority	14/05/2026	May 2028
Sgl/355952	39	Anstey Park, GU34 2RN	Adjacent Anstey Lane	472448-140338	51.1577182 - 0.9654083	paintings.crate.married	* Grass * Public access: high	Quercus palustris (Pin Oak)	1	6.0m	4.5m	22cm	* Typical of species and age	Fair	* No work required	No action required	14/05/2026	May 2028
Sgl/355960	41	Anstey Park, GU34 2RN	Adjacent Anstey Lane	472432-140356	51.1578778 - 0.9656413	stocks.snowballs.walls	* Grass * Public access: high	Quercus spp. (Oak species)	1	4.0m	2.0m	15cm	* Typical of species and age	Fair	* No work required	No action required	14/05/2026	May 2028
Sgl/355964	42	Anstey Park, GU34 2RN	Adjacent Anstey Lane	472419-140370	51.1580051 - 0.9658260	automate.vanished.sandbags	* Grass * Public access: high	Quercus ilex (Holm Oak)	1	3.5m	2.5m	15cm	* Ivy or climbing plants - Main stem * Typical of species and age	Fair	* No work required	No action required	14/05/2026	May 2028
Sgl/355968	43	Anstey Park, GU34 2RN	Adjacent Anstey Lane	472405-140386	51.1581545 - 0.9660192	downward.following.neatly	* Grass * Public access: high	Quercus robur 'Fastigiata' (Fastigate Oak)	1	6.0m	2.0m	20cm	* Ivy or climbing plants - Main stem * Mechanical damage to base of tree * Typical of species and age	Fair	* No work required	No action required	14/05/2026	May 2028
Sgl/355972	44	Anstey Park, GU34 2RN	Adjacent Anstey Lane	472397-140396	51.1582482 - 0.9661332	sank.mailings.caramel	* Grass * Public access: high	Quercus spp. (Oak species)	1	4.0m	5.0m	25cm	* Learning tree	Fair	* No work required	No action required	14/05/2026	May 2028
Sgl/355980	46	Anstey Park, GU34 2RN	Adjacent play ground	472425-140459	51.1588044 - 0.9657148	destined.edges.highly	* Dense under growth - Hedgerow * Public access: high	Acer pseudoplatanus (Sycamore)	4	14.0m	10.0m	5044cm	* Ivy or climbing plants - Main stem * Ivy restricting full inspection - Main stem * Minor dead wood <50mm * Multi-stemmed * Narrow forks with included bark	Fair	* Sever Ivy to 1.5m agl reporting all structural defects - Sever ivy at ground level and remove ivy from stem upto 1.5m above ground level. Report any major obvious defects to the tree officer.	High Priority	14/05/2026	May 2028
Sgl/355984	47	Anstey Park, GU34 2RN	Adjacent play ground	472423-140461	51.1588310 - 0.9657439	extremely.rebounded.posed	* Dense under growth - Hedgerow * Public access: high	Acer pseudoplatanus (Sycamore)	1	12.0m	6.0m	40cm	* Ivy or climbing plants - Main stem * Minor dead wood <50mm * Suppressed	Fair	* Basal/Epicomic growth removal * Sever Ivy to 1.5m agl reporting all structural defects	High Priority	14/05/2026	May 2028
Sgl/355992	49	Anstey Park, GU34 2RN	Adjacent Scouts club building	472441-140488	51.1590690 - 0.9654785	mornings.expecting.proclaims	* Grass * Public access: high	Acer pseudoplatanus (Sycamore)	1	10.0m	6.0m	55cm	* Ivy or climbing plants - Main stem * Typical of species and age	Fair	* No work required	No action required	14/05/2026	May 2028
Sgl/355996	50	Anstey Park, GU34 2RN	Adjacent Scouts club building	472440-140491	51.1590939 - 0.9654954	drones.warned.topic	* Grass * Public access: high	Acer pseudoplatanus (Sycamore)	1	14.0m	10.0m	60cm	* Ivy restricting full inspection - Main stem * Typical of species and age	Fair	* Sever Ivy to 1.5m agl reporting all structural defects	High Priority	14/05/2026	May 2028
Sgl/356000	51	Anstey Park, GU34 2RN	Adjacent Scouts club building	472443-140500	51.1591757 - 0.9654516	cope.completed.backyards	* Grass * Public access: high	Tilia x europaea (Common Lime)	1	6.0m	5.0m	30cm	* Basal and trunk suckers * Regrown pollard or topped tree	Fair	* Basal/Epicomic growth removal	Low Priority	14/05/2026	May 2028
Sgl/356004	52	Anstey Park, GU34 2RN	Adjacent Scouts club building	472451-140508	51.1592500 - 0.9653392	captures.singled.chum	* Grass * Public access: high	Tilia x europaea (Common Lime)	1	5.0m	5.0m	32cm	* Basal and trunk suckers * Regrown pollard or topped tree	Fair	* No work required	No action required	14/05/2026	May 2028
Sgl/356012	54	Anstey Park, GU34 2RN	Adjacent Scouts club building	472469-140513	51.1592899 - 0.9650816	passage.stones.flocking	* Grass * Public access: high	Acer pseudoplatanus (Sycamore)	1	12.0m	8.0m	50cm	* Evidence of recent major surgery * Roots/buttrresses - Other considerations - Raised soil level restricting VTA	Fair	* Grub out tree - Adjust soil level back to root flare within 50cm radial to tree	High Priority	14/05/2026	May 2028
Sgl/356016	55	Anstey Park, GU34 2RN	Adjacent Scouts club building & car park	472491-140481	51.1590007 - 0.9647687	author.generals.earlobes	* Grass * Public access: high	Tilia x europaea (Common Lime)	1	6.0m	5.0m	70cm	* Basal and trunk suckers - Restricting vta * Regrown pollard or topped tree	Fair	* Basal/Epicomic growth removal	High Priority	14/05/2026	May 2028
Sgl/356020	56	Anstey Park, GU34 2RN	Adjacent Scouts club building & car park	472485-140475	51.1589444 - 0.9648536	profiled.interval.expectant	* Grass * Public access: high	Tilia x europaea (Common Lime)	1	8.0m	6.0m	37cm	* Basal and trunk suckers * Narrow forks with included bark	Fair	* Basal/Epicomic growth removal	Low Priority	14/05/2026	May 2028
Sgl/356044	62	Anstey Park, GU34 2RN	Front of Royal Legion	472516-140452	51.1587385 - 0.9644105	intruding.tweed.offers	* Grass * Public access: high	Acer spp. (Maple species)	1	10.0m	9.0m	40cm	* Low branches * Raised roots/buttrressing	Fair	* Crown lift to 3 metres - Lift 2.5m	High Priority	14/05/2026	May 2028
Sgl/356048	63	Anstey Park, GU34 2RN	Front of Royal Legion	472524-140442	51.1586431 - 0.9643001	roaring.boomers.including	* Grass * Public access: high	Fraxinus spp. (Ash species)	1	7.0m	6.0m	34cm	* Ash Dieback - Health class 2: 51%-75% remaining canopy - Top of crown showing distress * Typical of species and age	Fair	* Crown lift to 3 metres - Lift 2.5m	High Priority	13/05/2026	May 2028
Sgl/356052	64	Anstey Park, GU34 2RN	Adjacent car park	472556-140410	51.1583527 - 0.9638536	parading.dignify.drag	* Grass * Public access: high	Acer campestre (Field Maple)	1	6.0m	6.5m	39cm	* Low branches	Fair	* Crown lift to 3 metres - Lift 2.5m	High Priority	13/05/2026	May 2028
Sgl/356056	65	Anstey Park, GU34 2RN	Adjacent Energieque car park	472450-140524	51.1593916 - 0.9653490	fight.candidate.blemishes	* Grass * Public access: high	Acer pseudoplatanus (Sycamore)	1	18.0m	6.0m	50cm	* Minor dead wood <50mm	Fair	* Crown lift to 3 metres	High Priority	14/05/2026	May 2028
Sgl/356060	66	Anstey Park, GU34 2RN	Adjacent Energieque car park	472455-140527	51.1594185 - 0.9652795	shrug.pens.gambles	* Grass * Public access: high	Acer pseudoplatanus (Sycamore)	1	18.0m	9.0m	70cm	* Bark wound on trunk (Minor) * Ivy or climbing plants - Main stem * Minor dead wood <50mm	Fair	* No work required	No action required	14/05/2026	May 2028
Sgl/356064	67	Anstey Park, GU34 2RN	Adjacent Energieque car park	472452-140531	51.1594495 - 0.9653172	onwards.deleting.dreading	* Grass * Public access: high	Acer pseudoplatanus (Sycamore)	2	18.0m	9.0m	50cm	* Die back isolated - Upper crown dieback on North East stem * Ivy or climbing plants - Main stem * Minor dead wood <50mm	Fair	* Remove dead and diseased wood	High Priority	14/05/2026	May 2028
Sgl/356068	68	Anstey Park, GU34 2RN	Adjacent Energieque car park	472443-140534	51.1594798 - 0.9654423	windmill.option.boasted	* Grass * Public access: high	Acer pseudoplatanus (Sycamore)	1	18.0m	7.0m	50cm	* Ivy or climbing plants - Main stem * Minor dead wood <50mm	Fair	* No work required	No action required	14/05/2026	May 2028
Sgl/356076	70	Anstey Park, GU34 2RN	Opposite Scouts Group building	472478-140524	51.1593848 - 0.9649416	tissue.regulator.footballers	* Grass * Public access: high	Fagus sylvatica (Common Beech)	1	10.0m	8.0m	50cm	* Low branches * Typical of species and age	Fair	* Crown lift to 3 metres	High Priority	14/05/2026	May 2028
Sgl/356080	71	Anstey Park, GU34 2RN	Opposite Scouts Group building	472485-140517	51.1593224 - 0.9648426	corporate.include.dweller	* Grass * Public access: high	Taxus baccata (Common Yew)	2	6.0m	7.0m	30cm	* Bark wound over 20% of stem - Occluding * Multi-stemmed * Typical of species and age	Fair	* No work required	No action required	14/05/2026	May 2028
Sgl/356084	72	Anstey Park, GU34 2RN	Opposite Scouts Group building	472487-140515	51.1593041 - 0.9648168	sway.ghost.browsers	* Grass * Public access: high	Acer pseudoplatanus (Sycamore)	1	17.0m	15.0m	70cm	* Basal and trunk suckers * Ivy or climbing plants - Main stem * Minor dead wood <50mm * Sparse crown	Fair	* No work required	No action required	14/05/2026	May 2028

Sgl/356088	73	Anstey Park, GU34 2RN	Opposite Scouts Group building	472488-140514	51.1592974 - 0.9648100	sway.ghost.browsers	* Grass * Public access: high	Taxus baccata (Common Yew)	1	7.0m	6.0m	30cm	* Basal and trunk suckers * Ivy or climbing plants - Main stem * Ivy restricting full inspection - Main stem * Typical of species and age	Fair	* No work required	No action required	14/05/2026	May 2028
Sgl/356092	74	Anstey Park, GU34 2RN	Opposite Scouts Group building	472489-140512	51.1592780 - 0.9647842	bugs.salmon.liver	* Grass * Public access: high	Taxus baccata (Common Yew)	1	6.0m	5.0m	30cm	* Basal and trunk suckers * Ivy or climbing plants - Main stem * Ivy restricting full inspection - Main stem * Suppressed * Typical of species and age	Fair	* Crown lift to 3 metres	Low Priority	14/05/2026	May 2028
Sgl/356096	75	Anstey Park, GU34 2RN	Opposite Scouts Group building	472491-140509	51.1592536 - 0.9647569	maybe.thud.cabs	* Grass * Public access: high	Taxus baccata (Common Yew)	1	6.0m	7.0m	35cm	* Basal and trunk suckers * Ivy or climbing plants - Main stem * Ivy restricting full inspection - Main stem * Typical of species and age	Fair	* Crown lift to 3 metres	Low Priority	14/05/2026	May 2028
Sgl/356100	76	Anstey Park, GU34 2RN	Opposite Scouts Group building	472495-140505	51.1592152 - 0.9647010	steaming.investors.breath	* Grass * Public access: high	Taxus baccata (Common Yew)	2	6.0m	6.0m	35cm	* Basal and trunk suckers * Ivy or climbing plants - Main stem * Codominant stems * Typical of species and age	Fair	* Crown lift to 3 metres	High Priority	14/05/2026	May 2028
Sgl/356104	77	Anstey Park, GU34 2RN	Opposite Scouts Group building	472499-140506	51.1592263 - 0.9646536	glaze.weekends.overruns	* Grass * Public access: high	Acer pseudoplatanus (Sycamore)	1	12.0m	9.0m	70cm	* Basal and trunk suckers * Decay - minor basal * Evidence of recent major surgery * Regrown pollard or lopped tree	Fair	* No work required	No action required	14/05/2026	May 2028
Sgl/356108	78	Anstey Park, GU34 2RN	Opposite Scouts Group building	472502-140500	51.1591678 - 0.9646087	approvals.depths.instant	* Grass * Public access: high	Tilia x europaea (Common Lime)	1	15.0m	7.0m	70cm	* Basal and trunk suckers - Lapsed basal suckers removal has caused dense woody vegetation growth which is restricting a full VTA. * Dense crown * Minor dead wood <50mm	Fair	* Basal/Epicomic growth removal - Basal suckers need to be carefully removed as close back to stem as possible to allow for inspection of trunk and buttress. (Approx. 1 hours work) Report any major obvious defects to the tree officer (major basal decay, fungal fruiting bodies. Etc)	High Priority	14/05/2026	May 2028
Sgl/356112	79	Anstey Park, GU34 2RN	Opposite Scouts Group building	472504-140496	51.1591285 - 0.9645738	sonic.validated.care	* Footpath Damage (Minor) * Grass * Public access: high * Telephone wires in canopy	Tilia x europaea (Common Lime)	1	15.0m	7.0m	70cm	* Basal and trunk suckers - Lapsed basal suckers removal has caused dense woody vegetation growth which is restricting a full VTA. * Cavity - South aspect approximately 2.5m above ground level * Dense crown * Minor dead wood <50mm * Regrown pollard or lopped tree	Fair	* Basal/Epicomic growth removal - Basal suckers need to be carefully removed as close back to stem as possible to allow for inspection of trunk and buttress. (Approx. 1 hours work) Report any major obvious defects to the tree officer (major basal decay, fungal fruiting bodies. Etc) * Remove dead and diseased wood	High Priority	14/05/2026	May 2028
Sgl/356116	80	Anstey Park, GU34 2RN	Adjacent Alton School gate	472459-140546	51.1595864 - 0.9652102	retaliate.revise.garlic	* Grass * Public access: high	Aesculus hippocastanum (Horse Chestnut)	2	11.0m	12.0m	50cm	* Large branches lost recently * Basal and trunk suckers * Bark wound over 20% of stem * Crossing branches * Historic pruning wounds - Water pocket at approx 1.5m above ground level * Ivy or climbing plants - Main stem * Low branches * Broken/Lost leader * Minor dead wood <50mm * Codominant stems * Trunk defect - Natural bracing between stems	Fair	* Basal/Epicomic growth removal * Sever ivy to 1.5m agl reporting all structural defects	High Priority	14/05/2026	May 2028
Sgl/356124	82	Anstey Park, GU34 2RN	Adjacent the Pavillion	472581-140414	51.1583824 - 0.9635003	shuffling.orchestra.sandals	* Grass * Public access: high	Pinus sylvestris (Scots Pine)	1	16.0m	8.0m	80cm	* Historic pruning wounds * Broken/Lost leader * Minor dead wood <50mm	Fair	* No work required	No action required	13/05/2026	May 2028
Sgl/356128	83	Anstey Park, GU34 2RN	Adjacent the Pavillion	472588-140425	51.1584802 - 0.9633917	sweeter.chemistry.swimsuits	* Grass * Public access: high	Tilia x europaea (Common Lime)	1	25.0m	14.0m	150cm	* Basal and trunk suckers - Restricting VTA * Historic pruning wounds * Major dead wood >50mm * Evidence of recent major surgery - Crown previously reduced * Codominant stems	Fair	* Basal/Epicomic growth removal - Report any fungi / defects * Remove dead and diseased wood	High Priority	13/05/2026	May 2028
Sgl/356132	84	Anstey Park, GU34 2RN	Adjacent the Pavillion	472592-140437	51.1585933 - 0.9633279	steps.tour.education	* Grass * Public access: high	Tilia x europaea (Common Lime)	1	25.0m	14.0m	150cm	* Basal and trunk suckers - Restricting vta * Historic pruning wounds * Major dead wood >50mm * Evidence of recent major surgery - Crown previously reduced * Codominant stems	Fair	* Basal/Epicomic growth removal - Report any fungi / defects * Remove dead and diseased wood	High Priority	13/05/2026	May 2028
Sgl/356136	85	Anstey Park, GU34 2RN	North side of access road from Anstey Rd	472587-140403	51.1582823 - 0.9634074	duration.joke.capacity	* Grass * Public access: high	Fagus sylvatica purpurea (Purple Beech)	1	9.0m	11.0m	35cm	* Low branches * Typical of species and age	Fair	* Crown lift to 2.5 metres	Low Priority	13/05/2026	May 2028
Sgl/356140	86	Anstey Park, GU34 2RN	North side of access road from Anstey Rd	472606-140386	51.1581322 - 0.9631377	insect.sway.stamp	* Grass * Public access: high	Larix spp. (Larch species)	1	16.0m	11.0m	95cm	* Major dead wood >50mm * Mechanical damage to roots * Raised roots/buttressing	Fair	Dead Wood 15-18m tree	High Priority	13/05/2026	May 2028
Sgl/356144	87	Anstey Park, GU34 2RN	North side of access road from Anstey Rd	472621-140372	51.1579986 - 0.9629293	dispenser.twisty.showrooms	* Grass * Public access: high	Acer pseudoplatanus (Sycamore)	1	14.0m	12.0m	95cm	* Historic pruning wounds * Minor dead wood <50mm * Raised roots/buttressing	Fair	* No work required	No action required	13/05/2026	May 2028
Sgl/356152	89	Anstey Park, GU34 2RN	North side of access road from Anstey Rd	472658-140341	51.1577184 - 0.9624041	partied.fear.deodorant	* Grass * Public access: high * Steel lamp	Tilia x europaea (Common Lime)	1	18.0m	10.0m	95cm	* Basal and trunk suckers - Restricting vta * Historic pruning wounds * Low branches * Minor dead wood <50mm * Narrow forks with included bark	Fair	* Basal/Epicomic growth removal - Report any fungi / defects * Crown lift to 3 metres	High Priority	13/05/2026	May 2028
Sgl/356156	90	Anstey Park, GU34 2RN	Adjacent Anstey Rd	472689-140345	51.1577492 - 0.9619652	vesting.barbarian.woes	* Grass * Public access: high	Aesculus hippocastanum (Horse Chestnut)	1	9.0m	9.0m	55cm	* Low branches * Typical of species and age	Fair	* Crown lift to 2.5 metres	Low Priority	13/05/2026	May 2028
Sgl/356160	91	Anstey Park, GU34 2RN	Adjacent Anstey Rd	472695-140354	51.1578312 - 0.9618761	chuckle.loafing.flippers	* Grass * Public access: high	Aesculus hippocastanum (Horse Chestnut)	1	9.0m	9.0m	50cm	* Low branches * Minor dead wood <50mm * Narrow forks with included bark	Fair	* Crown lift to 2.5 metres	Low Priority	13/05/2026	May 2028
Sgl/356164	92	Anstey Park, GU34 2RN	Adjacent Anstey Rd	472702-140363	51.1579066 - 0.9617706	defend.cluttered.text	* Grass * Public access: high	Aesculus hippocastanum (Horse Chestnut)	1	12.0m	9.0m	65cm	* Low branches * Minor dead wood <50mm * Typical of species and age	Fair	* Crown lift to 2.5 metres	Low Priority	13/05/2026	May 2028
Sgl/356168	93	Anstey Park, GU34 2RN	Adjacent Anstey Rd	472710-140372	51.1579885 - 0.9616553	slanting.blunders.shopper	* Grass * Public access: high * Steel lamp	Aesculus hippocastanum (Horse Chestnut)	1	12.0m	9.0m	60cm	* Low branches * Narrow forks with included bark * Typical of species and age	Fair	* Crown lift to 2.5 metres	Low Priority	13/05/2026	May 2028
Sgl/356172	94	Anstey Park, GU34 2RN	Adjacent Anstey Rd	472719-140379	51.1580565 - 0.9615280	eyelash.pixel.stitching	* Grass * Public access: high	Aesculus hippocastanum (Horse Chestnut)	1	12.0m	9.0m	70cm	* Low branches * Minor dead wood <50mm * Narrow forks with included bark * Typical of species and age	Fair	* Crown lift to 2.5 metres	Low Priority	13/05/2026	May 2028

Sgl/356176	95	Anstey Park, GU34 2RN	Adjacent Anstey Rd	472727-140387	51.1581252 - 0.9614131	cupc,toasters,chains	* Grass * Public access: high	Aesculus hippocastanum (Horse Chestnut)	1	12.0m	9.0m	70cm	* Low branches * Narrow forks with included bark * Typical of species and age	Fair	* Crown lift to 2.5 metres	Low Priority	13/05/2026	May 2028
Sgl/356180	96	Anstey Park, GU34 2RN	Adjacent Anstey Rd	472736-140397	51.1582146 - 0.9612837	gearbox,pursuit,couriers	* Grass * Public access: high	Aesculus hippocastanum (Horse Chestnut)	1	12.0m	9.0m	50cm	* Crossing branches * Low branches * Narrow forks with included bark * Typical of species and age	Fair	* Crown lift to 2.5 metres	Low Priority	13/05/2026	May 2028
Sgl/356184	97	Anstey Park, GU34 2RN	Adjacent Anstey Rd	472748-140430	51.1585040 - 0.9608146	searches,typed,reassured	* Grass * Public access: high	Liriodendron tulipifera (Tulip tree)	1	5.0m	4.0m	16cm	* Typical of species and age	Fair	* No work required	No action required	13/05/2026	May 2028
Sgl/356188	98	Anstey Park, GU34 2RN	Adjacent Anstey Rd	472793-140450	51.1586842 - 0.9604543	squaring,unlocky,tedious	* Grass * Public access: high	Liriodendron tulipifera (Tulip tree)	1	5.0m	3.0m	18cm	* Typical of species and age	Fair	* No work required	No action required	13/05/2026	May 2028
Sgl/356192	99	Anstey Park, GU34 2RN	Rear of 4 London Rd	472804-140495	51.1590867 - 0.9602970	presumes,hides,shatters	* Grass * Overhead electricity cables * Public access: high * Street lamp	Acer pseudoplatanus (Sycamore)	1	14.0m	18.0m	100cm	* Decay - minor basal - Minor basal decay East aspect * Fungi - Ganoderma adspersum/australe (Artist/Shell bracket) * Historic pruning wounds * Ivy or climbing plants - Main stem * Minor dead wood <50mm * Evidence of recent major surgery - Crown recently reduced	Fair	* No work required	No action required	13/05/2026	May 2028
Sgl/356196	100	Anstey Park, GU34 2RN	S/O 10-16 London Rd	472801-140501	51.1591413 - 0.9603289	scorching,briefer,monk	* Grass * Overhead electricity cables * Public access: high	Sorbus intermedia (Swedish Whitebeam)	1	7.0m	7.0m	40cm	* Ivy or climbing plants - Main stem * Ivy restricting full inspection - Main stem * Minor dead wood <50mm	Fair	* Sever Ivy to 1.5m agl reporting all structural defects - Sever ivy at ground level and remove ivy from stem upto 1.5m agl.	High Priority	13/05/2026	May 2028
Sgl/356200	101	Anstey Park, GU34 2RN	S/O 10-16 London Rd	472798-140504	51.1591637 - 0.9603686	onlookers,tram,fondest	* Grass * Overhead electricity cables * Public access: high	Sorbus intermedia (Swedish Whitebeam)	1	7.0m	7.0m	40cm	* Ivy or climbing plants - Main stem * Ivy restricting full inspection - Main stem * Minor dead wood <50mm	Fair	* Sever Ivy to 1.5m agl reporting all structural defects - Sever ivy at ground level and remove ivy from stem upto 1.5m agl.	High Priority	13/05/2026	May 2028
Sgl/356204	102	Anstey Park, GU34 2RN	S/O 10-16 London Rd	472797-140506	51.1591803 - 0.9603882	javelin,ladders,escalates	* Grass * Overhead electricity cables * Public access: high	Sorbus intermedia (Swedish Whitebeam)	1	7.0m	7.0m	35cm	* Ivy or climbing plants - Main stem * Ivy restricting full inspection - Main stem * Minor dead wood <50mm	Fair	* Sever Ivy to 1.5m agl reporting all structural defects - Sever ivy at ground level and remove ivy from stem upto 1.5m agl.	High Priority	13/05/2026	May 2028
Sgl/356208	103	Anstey Park, GU34 2RN	S/O 10-16 London Rd	472795-140508	51.1591981 - 0.9604140	copes,truffles,placidly	* Grass * Overhead electricity cables * Public access: high	Sorbus intermedia (Swedish Whitebeam)	1	7.0m	7.0m	40cm	* Ivy or climbing plants - Main stem * Ivy restricting full inspection - Main stem * Minor dead wood <50mm	Fair	* Sever Ivy to 1.5m agl reporting all structural defects - Sever ivy at ground level and remove ivy from stem upto 1.5m agl.	High Priority	13/05/2026	May 2028
Sgl/356212	104	Anstey Park, GU34 2RN	S/O 10-16 London Rd	472793-140509	51.1592158 - 0.9604381	supple,skips,conqueror	* Grass * Overhead electricity cables * Public access: high	Sorbus intermedia (Swedish Whitebeam)	1	7.0m	7.0m	30cm	* Ivy or climbing plants - Main stem * Ivy restricting full inspection - Main stem * Minor dead wood <50mm	Fair	* Sever Ivy to 1.5m agl reporting all structural defects - Sever ivy at ground level and remove ivy from stem upto 1.5m agl.	High Priority	13/05/2026	May 2028
Sgl/356216	105	Anstey Park, GU34 2RN	S/O 10-16 London Rd	472792-140512	51.1592353 - 0.9604655	streetcar,scans,logged	* Grass * Overhead electricity cables * Public access: high	Sorbus intermedia (Swedish Whitebeam)	1	7.0m	7.0m	40cm	* Ivy or climbing plants - Main stem * Ivy restricting full inspection - Main stem * Minor dead wood <50mm	Fair	* Sever Ivy to 1.5m agl reporting all structural defects - Sever ivy at ground level and remove ivy from stem upto 1.5m agl.	High Priority	13/05/2026	May 2028
Sgl/356220	106	Anstey Park, GU34 2RN	S/O 10-16 London Rd	472789-140514	51.1592559 - 0.9604974	bridge,plantings,dress	* Grass * Overhead electricity cables * Public access: high	Sorbus intermedia (Swedish Whitebeam)	1	7.0m	7.0m	40cm	* Ivy or climbing plants - Main stem * Ivy restricting full inspection - Main stem * Minor dead wood <50mm	Fair	* Sever Ivy to 1.5m agl reporting all structural defects - Sever ivy at ground level and remove ivy from stem upto 1.5m agl.	High Priority	13/05/2026	May 2028
Sgl/356224	107	Anstey Park, GU34 2RN	S/O 10-16 London Rd	472787-140517	51.1592831 - 0.9605255	videos,replied,overtones	* Grass * Overhead electricity cables * Public access: high	Sorbus intermedia (Swedish Whitebeam)	1	7.0m	7.0m	40cm	* Ivy or climbing plants - Main stem * Ivy restricting full inspection - Main stem * Minor dead wood <50mm	Fair	* Sever Ivy to 1.5m agl reporting all structural defects - Sever ivy at ground level and remove ivy from stem upto 1.5m agl.	High Priority	13/05/2026	May 2028
Sgl/356228	108	Anstey Park, GU34 2RN	S/O 10-16 London Rd	472785-140519	51.1593047 - 0.9605548	lookout,flame,reefs	* Grass * Overhead electricity cables * Public access: high	Sorbus intermedia (Swedish Whitebeam)	1	7.0m	7.0m	40cm	* Ivy or climbing plants - Main stem * Ivy restricting full inspection - Main stem * Minor dead wood <50mm	Fair	* Sever Ivy to 1.5m agl reporting all structural defects - Sever ivy at ground level and remove ivy from stem upto 1.5m agl.	High Priority	13/05/2026	May 2028
Sgl/356232	109	Anstey Park, GU34 2RN	S/O 10-16 London Rd	472783-140521	51.1593236 - 0.9605822	sheets,installs,explored	* Grass * Overhead electricity cables * Public access: high	Sorbus intermedia (Swedish Whitebeam)	1	7.0m	7.0m	40cm	* Ivy or climbing plants - Main stem * Ivy restricting full inspection - Main stem * Minor dead wood <50mm	Fair	* Sever Ivy to 1.5m agl reporting all structural defects - Sever ivy at ground level and remove ivy from stem upto 1.5m agl.	High Priority	13/05/2026	May 2028
Sgl/356236	110	Anstey Park, GU34 2RN	S/O 10-16 London Rd	472781-140523	51.1593381 - 0.9606099	blasted,dozed,finny	* Grass * Overhead electricity cables * Public access: high	Sorbus intermedia (Swedish Whitebeam)	1	7.0m	7.0m	40cm	* Ivy or climbing plants - Main stem * Ivy restricting full inspection - Main stem * Minor dead wood <50mm	Fair	* Sever Ivy to 1.5m agl reporting all structural defects - Sever ivy at ground level and remove ivy from stem upto 1.5m agl.	High Priority	13/05/2026	May 2028
Sgl/356240	111	Anstey Park, GU34 2RN	S/O 10-16 London Rd	472780-140525	51.1593564 - 0.9606287	wriggled,earliest,airless	* Grass * Overhead electricity cables * Public access: high	Sorbus intermedia (Swedish Whitebeam)	1	7.0m	7.0m	50cm	* Ivy or climbing plants - Main stem * Minor dead wood <50mm	Fair	* Sever Ivy to 1.5m agl reporting all structural defects	High Priority	13/05/2026	May 2028
Sgl/356244	112	Anstey Park, GU34 2RN	S/O 10-16 London Rd	472778-140526	51.1593648 - 0.9606502	factory,playfully,bongo	* Grass * Overhead electricity cables * Public access: high	Sorbus intermedia (Swedish Whitebeam)	1	7.0m	7.0m	40cm	* Ivy or climbing plants - Main stem * Minor dead wood <50mm	Fair	* Sever Ivy to 1.5m agl reporting all structural defects	High Priority	13/05/2026	May 2028
Sgl/356248	113	Anstey Park, GU34 2RN	S/O 10-16 London Rd	472776-140529	51.1593943 - 0.9606819	bonus,remark,merge	* Building within or touching canopy * Grass * Overhead electricity cables * Public access: high	Sorbus intermedia (Swedish Whitebeam)	1	7.0m	6.0m	40cm	* Ivy or climbing plants - Main stem * Ivy restricting full inspection - Main stem * Minor dead wood <50mm	Fair	* Sever Ivy to 1.5m agl reporting all structural defects - Sever ivy at ground level and remove ivy from stem upto 1.5m agl.	High Priority	13/05/2026	May 2028
Sgl/356252	114	Anstey Park, GU34 2RN	S/O 10-16 London Rd	472774-140531	51.1594104 - 0.9607068	vote,professes,dispersed	* Building within or touching canopy * Grass * Overhead electricity cables * Public access: high	Sorbus intermedia (Swedish Whitebeam)	1	7.0m	7.0m	40cm	* Ivy or climbing plants - Main stem * Minor dead wood <50mm	Fair	* Sever Ivy to 1.5m agl reporting all structural defects	High Priority	13/05/2026	May 2028
Sgl/356256	115	Anstey Park, GU34 2RN	S/O 10-16 London Rd	472773-140532	51.1594237 - 0.9607250	towers,fidelity,jail	* Building within or touching canopy * Grass * Overhead electricity cables * Public access: high	Sorbus intermedia (Swedish Whitebeam)	1	7.0m	7.0m	40cm	* Ivy or climbing plants - Main stem * Ivy restricting full inspection - Main stem * Minor dead wood <50mm	Fair	* Sever Ivy to 1.5m agl reporting all structural defects - Sever ivy at ground level and remove ivy from stem upto 1.5m agl.	High Priority	13/05/2026	May 2028
Sgl/356260	116	Anstey Park, GU34 2RN	S/O 10-16 London Rd	472771-140534	51.1594398 - 0.9607499	apply,meal,imperial	* Building within or touching canopy * Grass * Overhead electricity cables * Public access: high	Sorbus intermedia (Swedish Whitebeam)	1	7.0m	7.0m	40cm	* Ivy or climbing plants - Main stem * Ivy restricting full inspection - Main stem * Minor dead wood <50mm	Fair	* Sever Ivy to 1.5m agl reporting all structural defects - Sever ivy at ground level and remove ivy from stem upto 1.5m agl.	High Priority	13/05/2026	May 2028
Sgl/356264	117	Anstey Park, GU34 2RN	S/O 10-16 London Rd	472770-140536	51.1594537 - 0.9607696	conspire,possibly,shine	* Grass * Overhead electricity cables * Public access: high	Sorbus intermedia (Swedish Whitebeam)	1	7.0m	7.0m	40cm	* Ivy or climbing plants - Main stem * Ivy restricting full inspection - Main stem * Minor dead wood <50mm	Fair	* Sever Ivy to 1.5m agl reporting all structural defects - Sever ivy at ground level and remove ivy from stem upto 1.5m agl.	High Priority	13/05/2026	May 2028
Sgl/356268	118	Anstey Park, GU34 2RN	S/O 10-16 London Rd	472768-140537	51.1594666 - 0.9607938	events,search,accordion	* Grass * Overhead electricity cables * Public access: high	Sorbus intermedia (Swedish Whitebeam)	3	7.0m	7.0m	40cm	* Ivy or climbing plants - Main stem * Ivy restricting full inspection - Main stem * Minor dead wood <50mm	Fair	* Sever Ivy to 1.5m agl reporting all structural defects - Sever ivy at ground level and remove ivy from stem upto 1.5m agl.	High Priority	13/05/2026	May 2028
Sgl/356272	119	Anstey Park, GU34 2RN	S/O 10-16 London Rd	472766-140538	51.1594729 - 0.9608277	studs,players,farmland	* Grass * Overhead electricity cables * Public access: high	Sorbus intermedia (Swedish Whitebeam)	1	7.0m	7.0m	40cm	* Ivy or climbing plants - Main stem * Ivy restricting full inspection - Main stem * Minor dead wood <50mm	Fair	* Sever Ivy to 1.5m agl reporting all structural defects - Sever ivy at ground level and remove ivy from stem upto 1.5m agl.	High Priority	13/05/2026	May 2028
Sgl/356276	120	Anstey Park, GU34 2RN	S/O 10-16 London Rd	472763-140537	51.1594694 - 0.9608680	example,lamps,untruth	* Grass * Overhead electricity cables * Public access: high	Sorbus intermedia (Swedish Whitebeam)	1	8.0m	7.0m	40cm	* Ivy or climbing plants - Main stem * Ivy restricting full inspection - Main stem * Minor dead wood <50mm	Fair	* Sever Ivy to 1.5m agl reporting all structural defects - Sever ivy at ground level and remove ivy from stem upto 1.5m agl.	High Priority	13/05/2026	May 2028


Sgl/356280	121	Anstey Park, GU34 2RN	Central playing field	472710-140499	51.1591310 - 0.9616401	steers.cookbooks.humans	* Grass * Public access: high	Aesculus hippocastanum (Horse Chestnut)	1	15.0m	18.0m	110cm	* Cavity - South aspect approximately 3m above ground level * Historic pruning wounds * Major dead wood >50mm * Minor dead wood <50mm * Main stem rot - South aspect approximately 3m above ground level. Occluding * Evidence of recent major surgery	Fair	* Remove dead and diseased wood	High Priority	13/05/2026	May 2028
Sgl/356284	122	Anstey Park, GU34 2RN	Eggar's School boundary	472755-140536	51.1594562 - 0.9609825	bunny.grazed.differs	* Grass * Public access: high	Platanus x hispanica (London Plane)	1	12.0m	12.0m	60cm	* Ivy or climbing plants - Main stem * Ivy restricting full inspection - Main stem * Low branches * Minor dead wood <50mm	Fair	* Sever ivy to 1.5m agl reporting all structural defects - Sever ivy at ground level and remove ivy from stem upto 1.5m agl	High Priority	13/05/2026	May 2028
Sgl/356288	123	Anstey Park, GU34 2RN	Eggar's School boundary	472750-140536	51.1594589 - 0.9610480	ounce.legend.nickname	* Grass * Public access: high	Alnus cordata (Italian Alder)	1	12.0m	9.0m	60cm	* Ivy or climbing plants - Main stem * Ivy restricting full inspection - Main stem * Low branches * Minor dead wood <50mm	Fair	* Sever ivy to 1.5m agl reporting all structural defects - Sever ivy at ground level and remove ivy from stem upto 1.5m agl	High Priority	13/05/2026	May 2028
Sgl/356292	124	Anstey Park, GU34 2RN	Eggar's School boundary	472735-140538	51.1594774 - 0.9612753	flattery.stuffing.huddle	* Grass * Public access: high	Alnus cordata (Italian Alder)	1	13.0m	10.0m	70cm	* Ivy or climbing plants - Main stem * Ivy restricting full inspection - Main stem * Low branches * Minor dead wood <50mm	Fair	* Sever ivy to 1.5m agl reporting all structural defects - Sever ivy at ground level and remove ivy from stem upto 1.5m agl	High Priority	13/05/2026	May 2028
Sgl/356296	125	Anstey Park, GU34 2RN	Eggar's School boundary	472720-140541	51.1595066 - 0.9614798	distanced.brass.minute	* Grass * Public access: high	Quercus robur (English Oak)	1	10.0m	9.0m	40cm	* Ivy restricting full inspection - Main stem	Fair	* Sever ivy to 1.5m agl reporting all structural defects	High Priority	13/05/2026	May 2028
Sgl/356300	126	Anstey Park, GU34 2RN	Eggar's School boundary	472705-140543	51.1595306 - 0.9617002	deliving.dinner.electrode	* Grass * Public access: high	Fraxinus excelsior (Common Ash)	1	6.0m	7.0m	25cm	* Ash Dieback - Health Class 1: 76%-100% remaining canopy * Ivy or climbing plants - Main stem * Ivy restricting full inspection - Main stem	Fair	* Sever ivy to 1.5m agl reporting all structural defects	High Priority	13/05/2026	May 2028
Sgl/356304	127	Anstey Park, GU34 2RN	Eggar's School boundary	472688-140547	51.1595651 - 0.9619428	trendy.stiletto.presented	* Grass * Public access: high	Quercus robur (English Oak)	1	15.0m	18.0m	125cm	* Basal rot - Percussion testing indicates no obvious sounds of decay. * Cavity - Large occluding wound South aspect, 2-3m above ground level, healthy amount of wound wood. Cavities also at 5-6m West aspect, approx 1.5m above primary union on both stems * Fungal fruiting bodies (Not identifiable) - Grifola frondosa located ground level North East aspect * Fungi - Laetiporus sulphureus (Chicken of the woods) - Located on pruning wound 2.5m agl South East aspect * Historic pruning wounds * Minor dead wood <50mm * Main stem rot - Decay within cavity * Evidence of recent major surgery - Tree responded well to crown reduction, Crown vitality good characterised by healthy leaf colouration. * Large pruning wounds	Fair	* Young tree maintenance - Veteran tree management plan - Reduce target occupancy; Install knee-High wooden diamond single rail fencing in line with the canopies crown drip line. (Southern field side) Soil improvement: Apply old woodchip mulch under Southern canopy, to a depth of 10cm.	High Priority	13/05/2026	May 2028
Sgl/356308	128	Anstey Park, GU34 2RN	Eggar's School boundary	472675-140554	51.1596331 - 0.9621220	performed.cascaded.lotteries	* Grass * Public access: high	Alnus cordata (Italian Alder)	1	12.0m	8.0m	55cm	* Major cavity over 10% of stem - Large cavity / defect @2m agl south aspect, no audible signs of cavitation * Ivy or climbing plants - Main stem * Minor dead wood <50mm	Fair	* No work required	No action required	13/05/2026	May 2028
Sgl/356312	129	Anstey Park, GU34 2RN	Eggar's School boundary	472682-140553	51.1596180 - 0.9620245	princely.subway.trumped	* Grass * Public access: high	Quercus robur (English Oak)	1	8.0m	8.0m	30cm	* Asymmetrical crown * Ivy or climbing plants - Main stem * Minor dead wood <50mm * Suppressed	Fair	* No work required	No action required	13/05/2026	May 2028
Sgl/356316	130	Anstey Park, GU34 2RN	Eggar's School boundary	472681-140553	51.1596225 - 0.9620437	velocity.landlady.collides	* Grass * Public access: high	Quercus robur (English Oak)	1	9.0m	8.0m	34cm	* Ivy or climbing plants - Main stem * Minor dead wood <50mm * Suppressed	Fair	* No work required	No action required	13/05/2026	May 2028
Sgl/356320	131	Anstey Park, GU34 2RN	Eggar's School boundary	472680-140554	51.1596308 - 0.9620496	velocity.landlady.collides	* Grass * Public access: high	Quercus robur (English Oak)	1	8.0m	8.0m	38cm	* Ivy or climbing plants - Main stem * Minor dead wood <50mm * Suppressed	Fair	* No work required	No action required	13/05/2026	May 2028
Sgl/356324	132	Anstey Park, GU34 2RN	Eggar's School boundary	472679-140556	51.1596469 - 0.9620694	walked.ladders.decisions	* Grass * Public access: high	Quercus robur (English Oak)	1	9.0m	8.0m	40cm	* Ivy or climbing plants - Main stem * Minor dead wood <50mm	Fair	* No work required	No action required	13/05/2026	May 2028
Sgl/356328	133	Anstey Park, GU34 2RN	Eggar's School boundary	472678-140557	51.1596608 - 0.9620865	craftsmen.earphones.contracts	* Grass * Public access: high	Quercus robur (English Oak)	1	7.0m	7.0m	35cm	* Asymmetrical crown * Ivy or climbing plants - Main stem * Minor dead wood <50mm * Suppressed	Fair	* No work required	No action required	13/05/2026	May 2028
Sgl/356336	135	Anstey Park, GU34 2RN	Eggar's School boundary	472647-140591	51.1599692 - 0.9625173	invoices.reclining.sprawls	* Grass * Public access: high	Quercus robur (English Oak)	2	10.0m	20.0m	50cm	* Ivy or climbing plants - Main stem * Minor dead wood <50mm * Multi-stemmed * Narrow forks with included bark	Fair	* No work required	No action required	13/05/2026	May 2028
Sgl/356340	136	Anstey Park, GU34 2RN	Eggar's School boundary	472639-140595	51.1600015 - 0.9626244	roadways.boat.lame	* Grass * Public access: high * Wall or fence within canopy spread	Platanus x hispanica (London Plane)	1	9.0m	10.0m	40cm	* Typical of species and age	Fair	* Sever ivy to 1.5m agl reporting all structural defects	High Priority	13/05/2026	May 2028
Sgl/356344	137	Anstey Park, GU34 2RN	Eggar's School boundary	472635-140598	51.1600343 - 0.9626803	stint.builders.peach	* Grass * Public access: high	Alnus cordata (Italian Alder)	1	10.0m	8.0m	40cm	* Typical of species and age	Fair	* No work required	No action required	13/05/2026	May 2028
Sgl/356348	138	Anstey Park, GU34 2RN	Eggar's School boundary	472630-140604	51.1600861 - 0.9627525	yummy.gravitate.shipped	* Grass * Public access: high	Castanea sativa (Sweet Chestnut)	1	13.0m	14.0m	173cm	* Basal and trunk suckers * Decay - minor basal * Decay in historic pruning wound * Decay in crown * Major dead wood >50mm * Main stem rot - Minor decay * Large pruning wounds * Trunk defect	Fair	* Basal/Epicomic growth removal * Remove dead and diseased wood	High Priority	13/05/2026	May 2028


Sgl/356352	139	Anstey Park, GU34 2RN	Eggar's School boundary	472627-140608	51.1401205 - 0.9628032	garden.habits.dished	* Grass * Public access: high	Castanea sativa (Sweet Chestnut)	1	13.0m	16.0m	163cm	* Large branches lost recently * Basal and trunk suckers * Bark wound over 20% of stem * Decay - minor basal - Fire damage * Decay in historic pruning wound * Decay in crown * Minor dead wood <50mm * Main stem rot - Minor decay * Evidence of recent major surgery * Main Stem/Trunk - Other considerations - Trunk cavity 2.5m above ground level North Western aspect! * Large pruning wounds * Trunk defect	Fair	* No work required	No action required	13/05/2026	May 2028
Sgl/356356	140	Anstey Park, GU34 2RN	Eggar's School boundary	472620-140615	51.1401828 - 0.9628918	sparrows.plodded.savings	* Grass * Public access: high	Alnus cordata (Italian Alder)	1	9.0m	8.0m	40cm	* Ivy or climbing plants - Main stem * Typical of species and age	Fair	* Sever Ivy to 1.5m agl reporting all structural defects	High Priority	13/05/2026	May 2028
Sgl/356360	141	Anstey Park, GU34 2RN	Eggar's School boundary	472617-140619	51.1602237 - 0.9629362	concerned.standing.waking	* Grass * Public access: high	Platanus x hispanica (London Plane)	1	9.0m	8.0m	45cm	* Ivy or climbing plants - Main stem * Raised roots/buttressing - Mower damage	Fair	* Sever Ivy to 1.5m agl reporting all structural defects	High Priority	13/05/2026	May 2028
Sgl/356364	142	Anstey Park, GU34 2RN	Eggar's School boundary	472616-140631	51.1603287 - 0.9629540	prevents.flown.violinist	* Grass * Public access: high	Crataegus monogyna (Hawthorn)	1	3.0m	4.0m	20cm	* Asymmetrical crown * Ivy or climbing plants - Main stem * Suppressed	Fair	* No work required	No action required	13/05/2026	May 2028
Sgl/356368	143	Anstey Park, GU34 2RN	Eggar's School boundary	472614-140632	51.1603394 - 0.9629816	juicy.smoke.likening	* Grass * Public access: high	Quercus robur (English Oak)	1	8.0m	8.0m	44cm	* Ivy or climbing plants - Main stem * Minor dead wood <50mm	Fair	* No work required	No action required	13/05/2026	May 2028
Sgl/356372	144	Anstey Park, GU34 2RN	Eggar's School boundary	472613-140633	51.1603461 - 0.9629972	juicy.smoke.likening	* Grass * Public access: high	Acer pseudoplatanus (Sycamore)	1	8.0m	7.0m	28cm	* Ivy or climbing plants - Main stem * Minor dead wood <50mm * Narrow forks with included bark * Codominant stems	Fair	* No work required	No action required	13/05/2026	May 2028
Sgl/356376	145	Anstey Park, GU34 2RN	Eggar's School boundary	472612-140634	51.1603567 - 0.9630083	juicy.smoke.likening	* Grass * Public access: high	Quercus robur (English Oak)	1	6.0m	6.0m	30cm	* Asymmetrical crown * Ivy or climbing plants - Main stem * Minor dead wood <50mm * Suppressed	Fair	* No work required	No action required	13/05/2026	May 2028
Sgl/356380	146	Anstey Park, GU34 2RN	Eggar's School boundary	472610-140637	51.1603838 - 0.9630374	spoke.lived.hence	* Grass * Public access: high	Quercus robur (English Oak)	1	5.0m	7.0m	30cm	* Asymmetrical crown * Ivy or climbing plants - Main stem * Minor dead wood <50mm * Suppressed	Fair	* No work required	No action required	13/05/2026	May 2028
Sgl/356384	147	Anstey Park, GU34 2RN	Eggar's School boundary	472602-140648	51.1604820 - 0.9631531	sizing.apart.attention	* Grass * Public access: high	Acer pseudoplatanus (Sycamore)	1	7.0m	7.0m	20cm	* Ivy restricting full inspection - Main stem	Fair	* No work required	No action required	13/05/2026	May 2028
Sgl/356388	148	Anstey Park, GU34 2RN	Eggar's School boundary	472606-140635	51.1603657 - 0.9630963	whistling.clenching.sprays	* Grass * Public access: high	Quercus robur (English Oak)	1	12.0m	12.0m	130cm	* Basal rot * Die back whole crown * Ivy or climbing plants - Main stem * Evidence of recent major surgery * Large pruning wounds * Regrown pollard or lopped tree * Possible wildlife	Dead	* Reduce and reshape crown by 2.5m - Ongoing incremental reduction to manage habitat stem. Remove any unstable branches.	High Priority	13/05/2026	May 2028
Sgl/356392	149	Anstey Park, GU34 2RN	North of playing field	472579-140664	51.1606347 - 0.9634708	rent.stolen.cones	* Grass * Public access: high	Fraxinus excelsior (Common Ash)	1	8.0m	7.0m	40cm	* Ash Dieback - Health Class 1: 76%-100% remaining canopy * Ivy or climbing plants - Main stem	Fair	* Sever Ivy to 1.5m agl reporting all structural defects	High Priority	13/05/2026	May 2028
Sgl/356400	151	Anstey Park, GU34 2RN	North of playing field	472556-140692	51.1608883 - 0.9637959	diplomas.firming.responded	* Grass * Public access: high	Fraxinus excelsior (Common Ash)	9	8.0m	10.0m	30cm	* Ash Dieback - Health Class 1: 76%-100% remaining canopy * Ivy or climbing plants - Main stem * Multi-stemmed	Fair	* No work required	No action required	13/05/2026	May 2028
Sgl/356404	152	Anstey Park, GU34 2RN	North of playing field	472541-140699	51.1609495 - 0.9640032	hotspot.kite.comedy	* Grass * Public access: high	Fagus sylvatica purpurea (Purple Beech)	1	9.0m	8.0m	46cm	* Historic pruning wounds * Low branches * Typical of species and age	Fair	* No work required	No action required	13/05/2026	May 2028
Sgl/441592	153	Anstey Park, GU34 2RN	Adj Anstey Lan	472561-140228	51.1567112 - 0.9638118	help.everybody.lifestyle	* Grass * Public access: high	Quercus spp. (Oak species)	1	3.0m	1.0m	7cm	* Staked tree * Typical of species and age	Fair	* Young tree maintenance - Careful remove grass 50cm radial to stem to a depth of 5cm and apply woodchip mulch 8-10cm deep, to help improve tree vitality. Remove stake and tie	High Priority	13/05/2026	May 2028
Sgl/441596	154	Anstey Park, GU34 2RN	Adj Anstey Lan	472550-140238	51.1568086 - 0.9639685	preheated.clearing.polite	* Grass * Public access: high	Tilia spp. (Lime species)	1	3.5m	1.5m	6cm	* Typical of species and age	Fair	* Basal/Epicomic growth removal * Remove hanging branch/limb - Formative prune and remove stake and tie * Young tree maintenance - Careful remove grass 50cm radial to stem to a depth of 5cm and apply woodchip mulch 8-10cm deep, to help improve tree vitality	High Priority	13/05/2026	May 2028
Sgl/441864	155	Anstey Park, GU34 2RN	Adj Anstey Lan	472541-140248	51.1568976 - 0.9640948	should.whisk.cools	* Grass * Public access: high	Carpinus betulus (Hornbeam)	1	3.5m	1.0m	8cm	* Staked tree	Fair	* Young tree maintenance - Apply old woodchip mulch 50cm radial to stem to a depth of 8-10cm	High Priority	13/05/2026	May 2028
Sgl/441868	156	Anstey Park, GU34 2RN	Adj Anstey Lan	472530-140257	51.1569829 - 0.9642526	acrobatic.mute.station	* Grass * Public access: high	Carpinus betulus (Hornbeam)	1	4.0m	1.0m	6cm	* Staked tree	Fair	* Young tree maintenance - Apply old woodchip mulch 50cm radial to stem to a depth of 8-10cm	High Priority	13/05/2026	May 2028
Sgl/862000	157	Anstey Park, GU34 2RN	Adj to football ground	472511-140331	51.1576447 - 0.9645179	cushy.soon.escapes	None recorded..	Fagus sylvatica (Common Beech)	1	3.0m	1.0m	5cm	* Staked tree	Fair	* No work required	No action required	13/05/2026	May 2028
Sgl/862004	158	Anstey Park, GU34 2RN	Adj to footpath	472613-140358	51.1578761 - 0.9630537	finishing.uproot.joystick	* Grass	Tilia spp. (Lime species)	1	3.0m	0.5m	8cm	* Staked tree	Fair	* No work required	No action required	13/05/2026	May 2028
Sgl/862008	159	Anstey Park, GU34 2RN	Adj to footpath	472634-140360	51.1578929 - 0.9627503	protected.extension.wifless	* Grass	Fagus sylvatica (Common Beech)	1	2.5m	0.5m	5cm	* Staked tree	Fair	* No work required	No action required	13/05/2026	May 2028
Sgl/862012	160	Anstey Park, GU34 2RN	Adj to London Road boundary	472683-140337	51.1576821 - 0.9620531	indulgent.heads.smelter	* Grass	Ulmus spp. (Elm species)	1	3.0m	0.5m	8cm	* Staked tree	Fair	* No work required	No action required	13/05/2026	May 2028
Sgl/862016	161	Anstey Park, GU34 2RN	Adj to London Road boundary	472759-140420	51.1584192 - 0.9609480	sound.providing.highlighted	* Grass	Crataegus monogyna (Hawthorn)	1	2.5m	0.5m	6cm	* Staked tree	Fair	* No work required	No action required	13/05/2026	May 2028
Sgl/862024	162	Anstey Park, GU34 2RN	Adj to London Road boundary	472786-140443	51.1586213 - 0.9605618	florists.searches.strides	* Grass	Tilia spp. (Lime species)	1	2.5m	0.5m	5cm	* Stake or tie damage	Fair	* Young tree maintenance - Re-tie	High Priority	13/05/2026	May 2028
Sgl/862028	163	Anstey Park, GU34 2RN	Adj to London Road boundary	472778-140437	51.1585692 - 0.9606700	chuckle.radiated.pupils	* Grass	Carpinus betulus (Hornbeam)	1	2.5m	0.5m	7cm	* Staked tree	Good	* No work required	No action required	13/05/2026	May 2028
Sgl/862032	164	Anstey Park, GU34 2RN	Adj to Edgar Hall	472374-140473	51.1589400 - 0.9644476	unhappily.endearing.flags	* Building within or touching canopy * Grass * Public access: high	Sorbus aria (Whitebeam)	1	8.0m	7.0m	36cm	* Decay - minor basal * Low branches	Fair	* Crown lift to 3 metres Reduce back from structure 6-9m tree	High Priority	15/05/2026	May 2028


Sgl/862036	165	Anstey Park, GU34 2RN	Adj to Edgar Hall	472355-140454	51.1587708 - 0.9667244	polished.switched.provoking	* Public access: High	Fagus sylvatica (Common Beech)	1	14.0m	12.0m	60cm	* Crossing branches * Low branches * Codominant stems * Possible wildlife	Good	* Crown lift to 3 metres	High Priority	15/05/2026	May 2028
------------	-----	-----------------------	-------------------	---------------	------------------------	-----------------------------	-----------------------	--------------------------------	---	-------	-------	------	--	------	--------------------------	---------------	------------	----------


Priority	Priority Key (incl timescale) Colour	Timescale
No action required		No Timescale
Low Priority		24 Months
High Priority		12 Months
Urgent-Public safety		1 Month


Appendix 2: Tree Location Plans

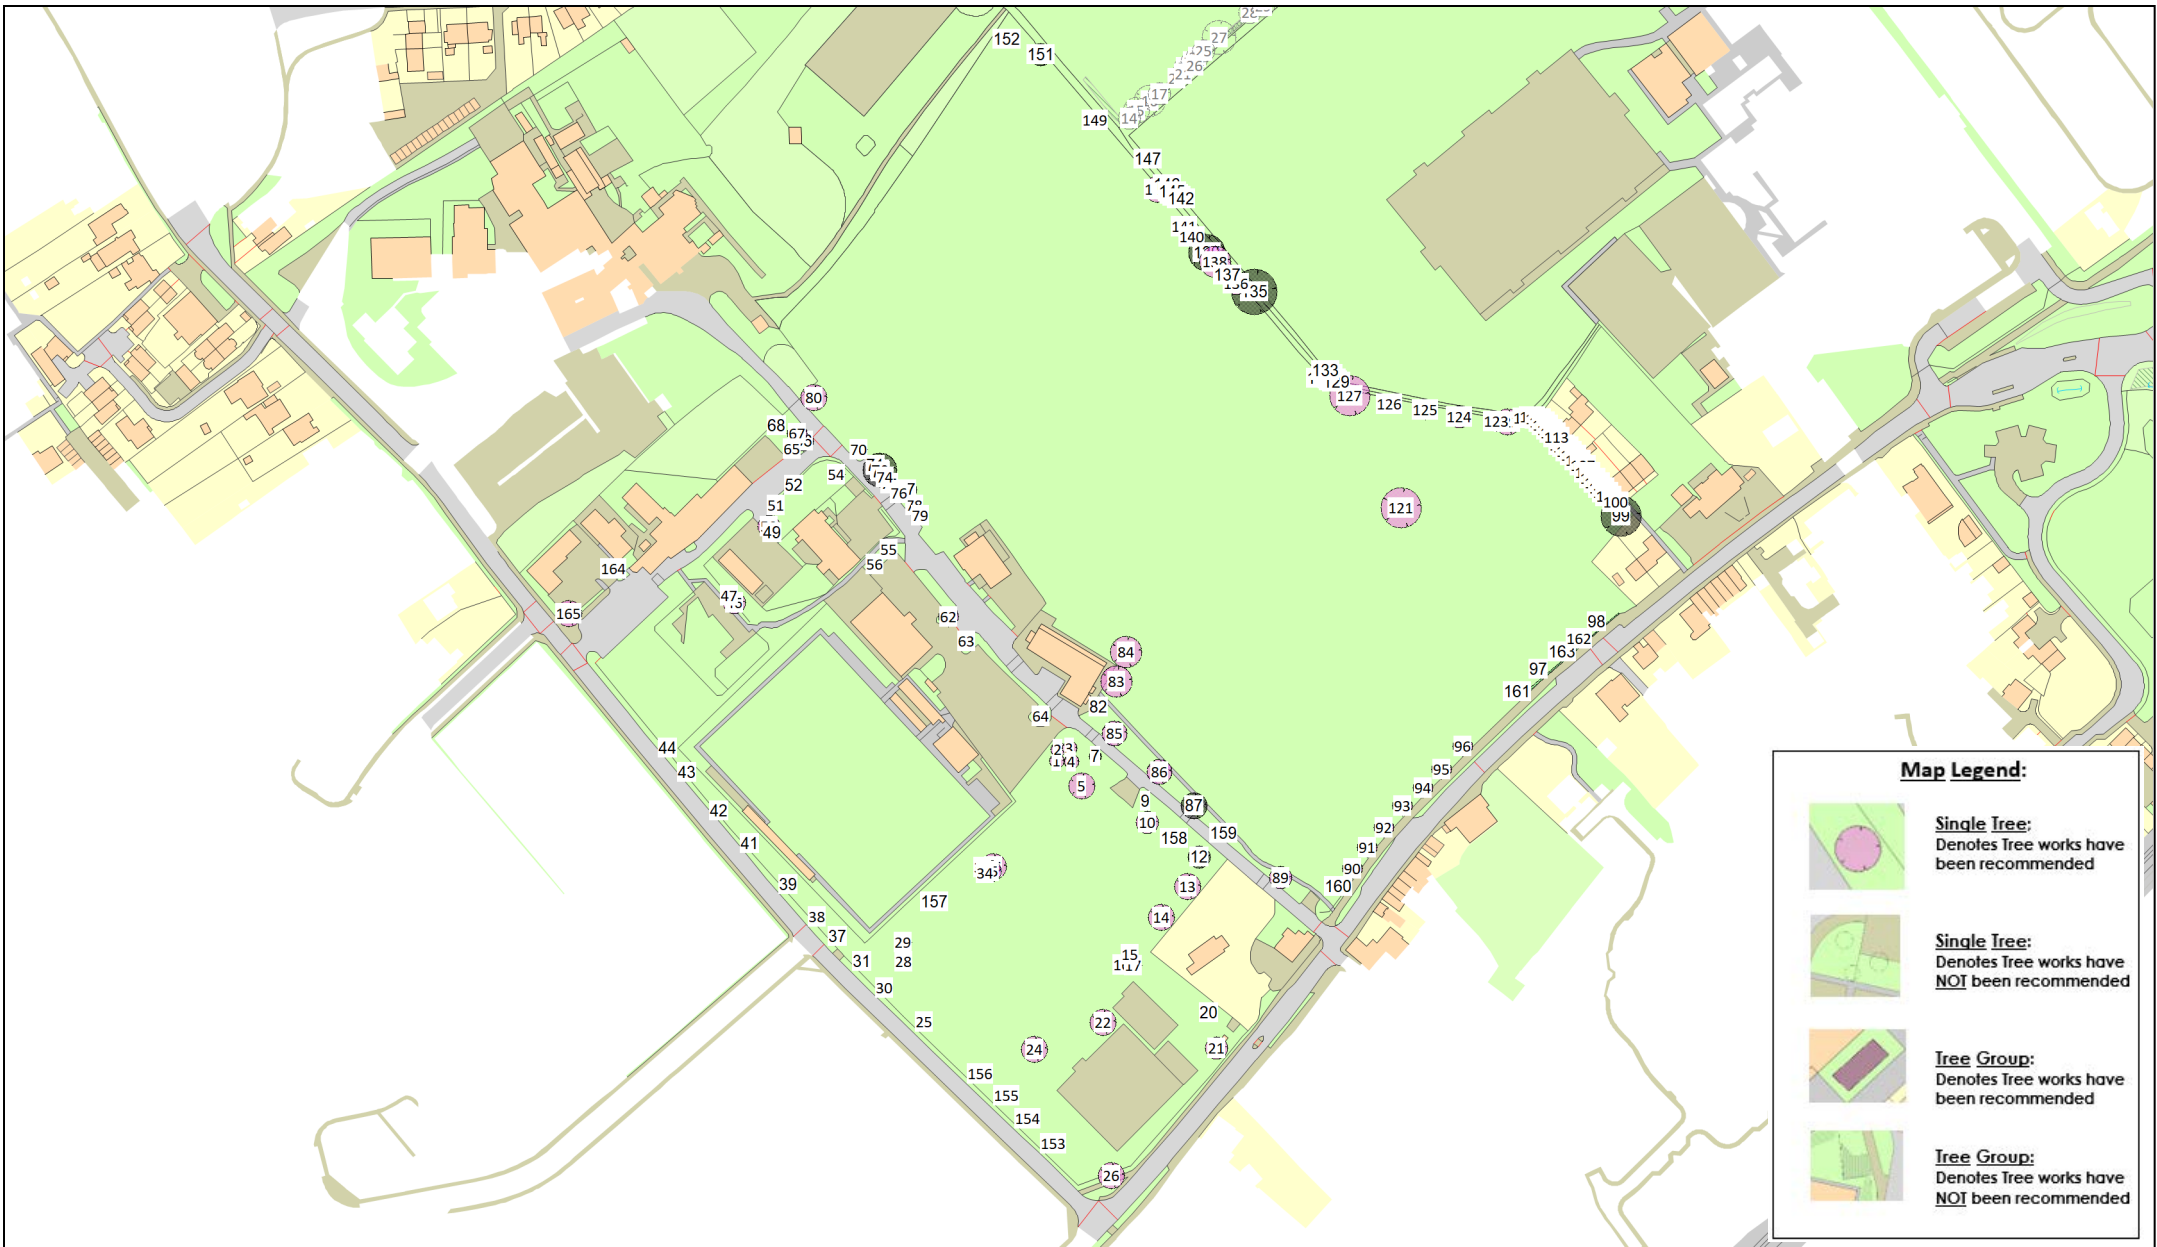


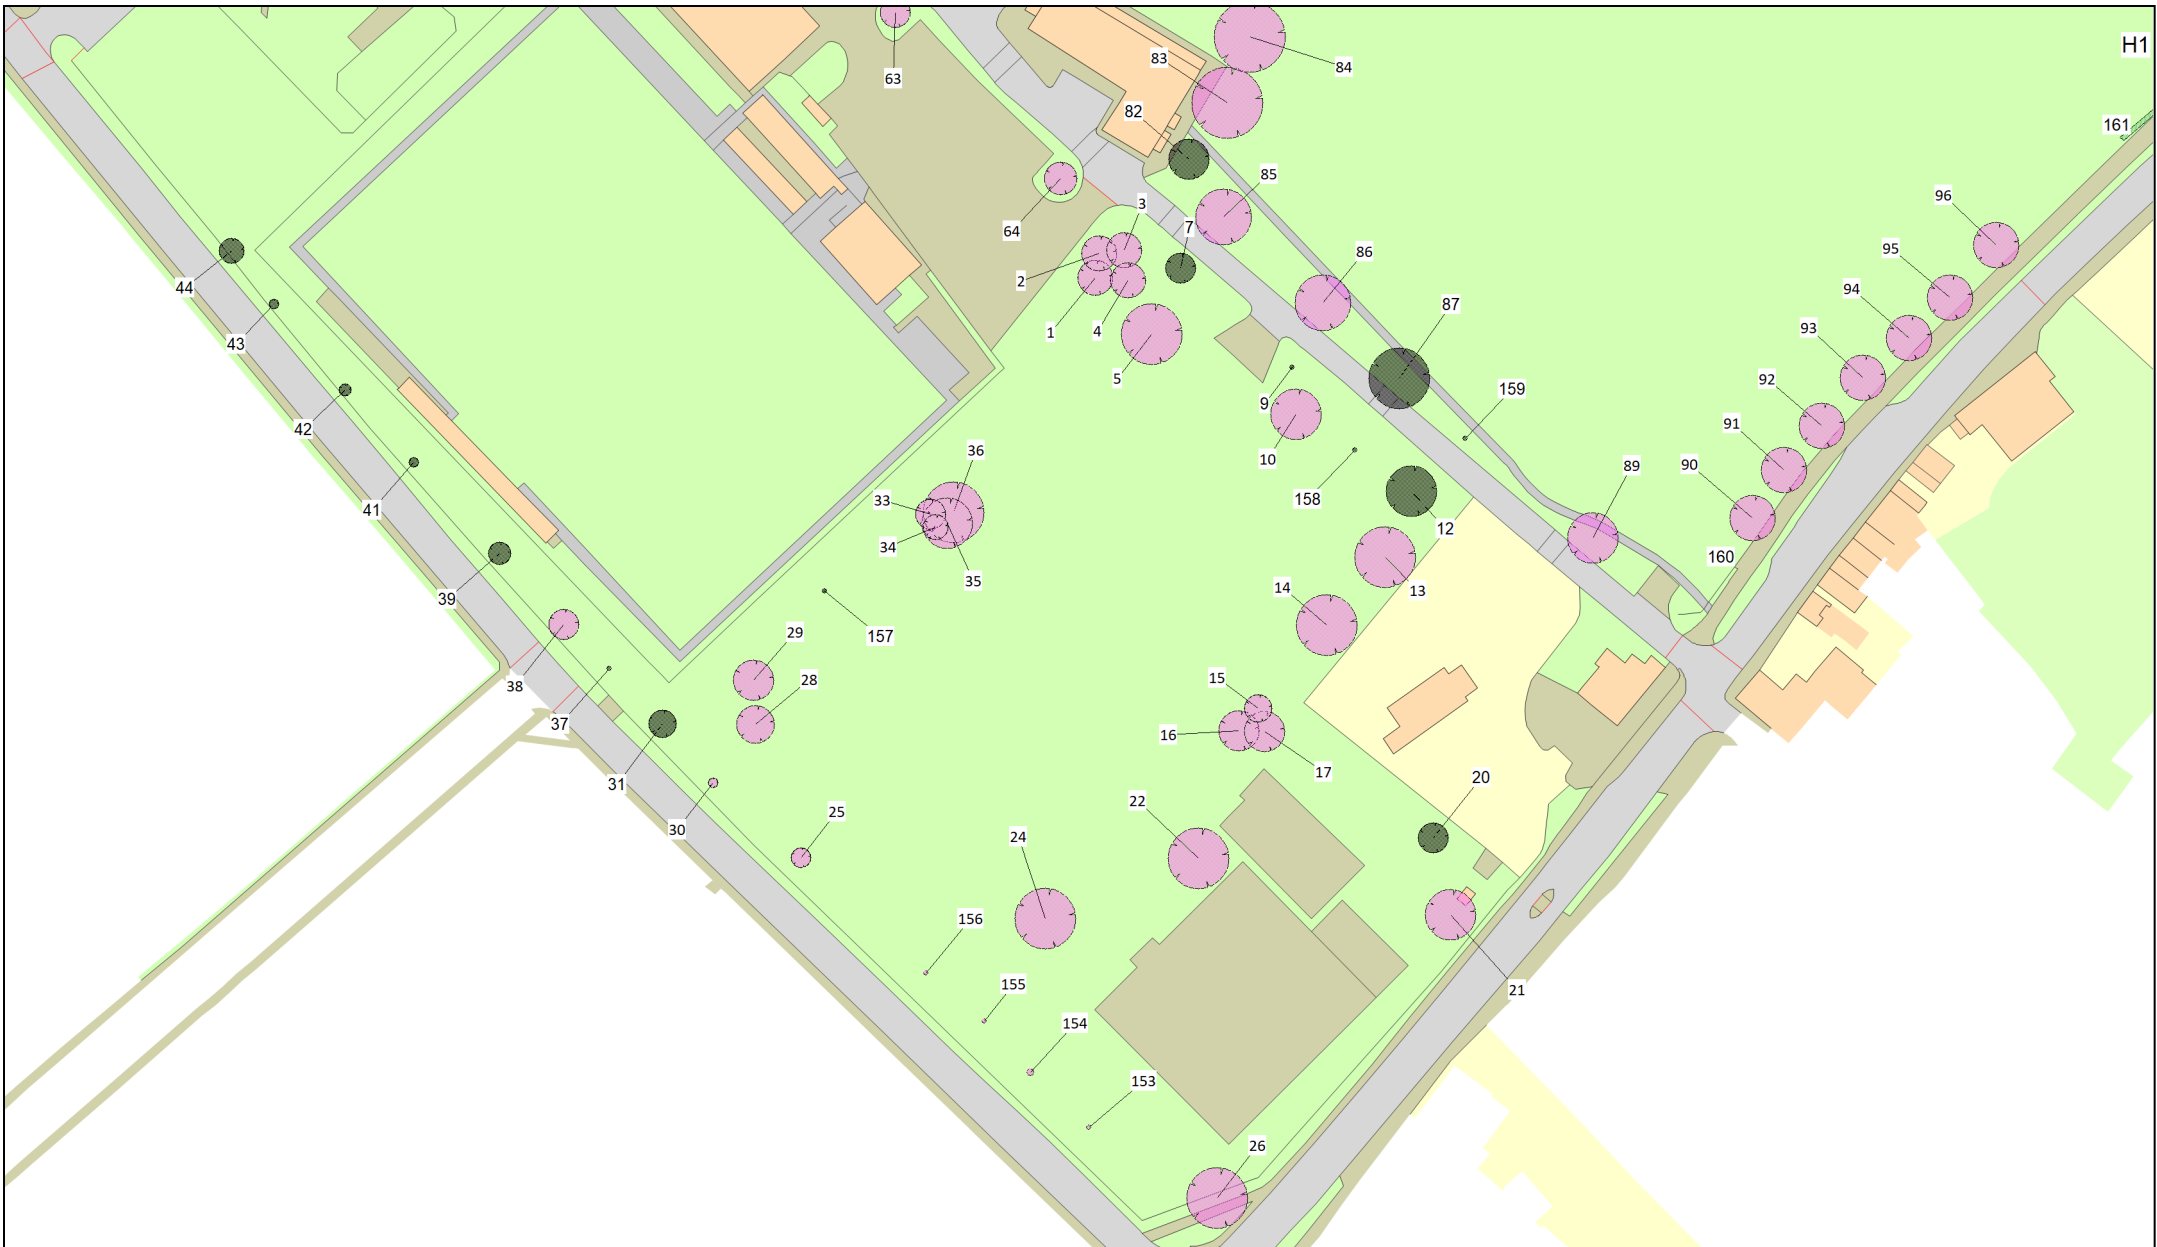

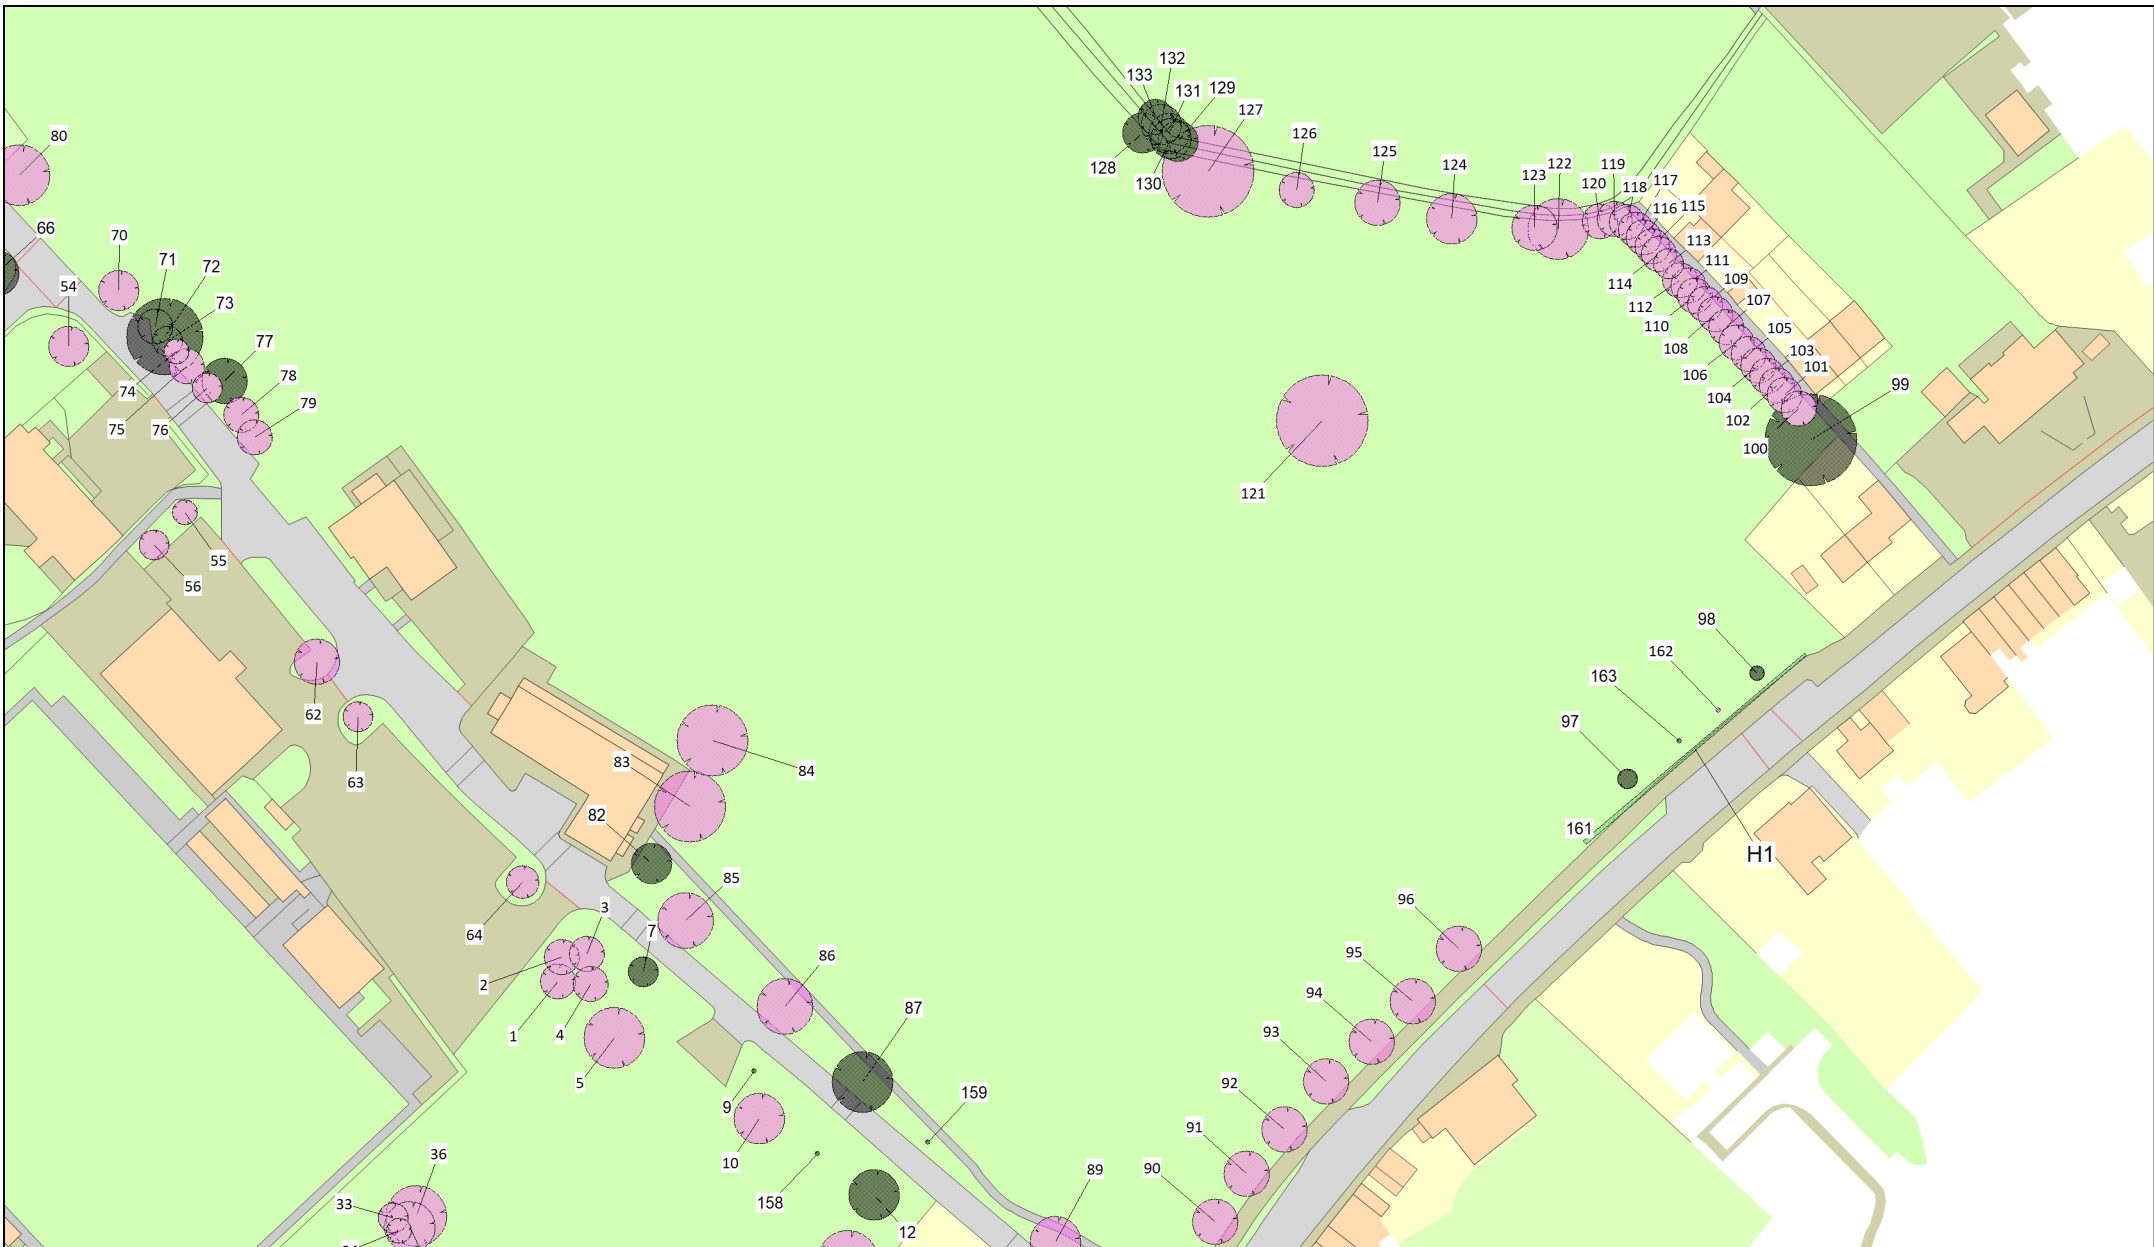

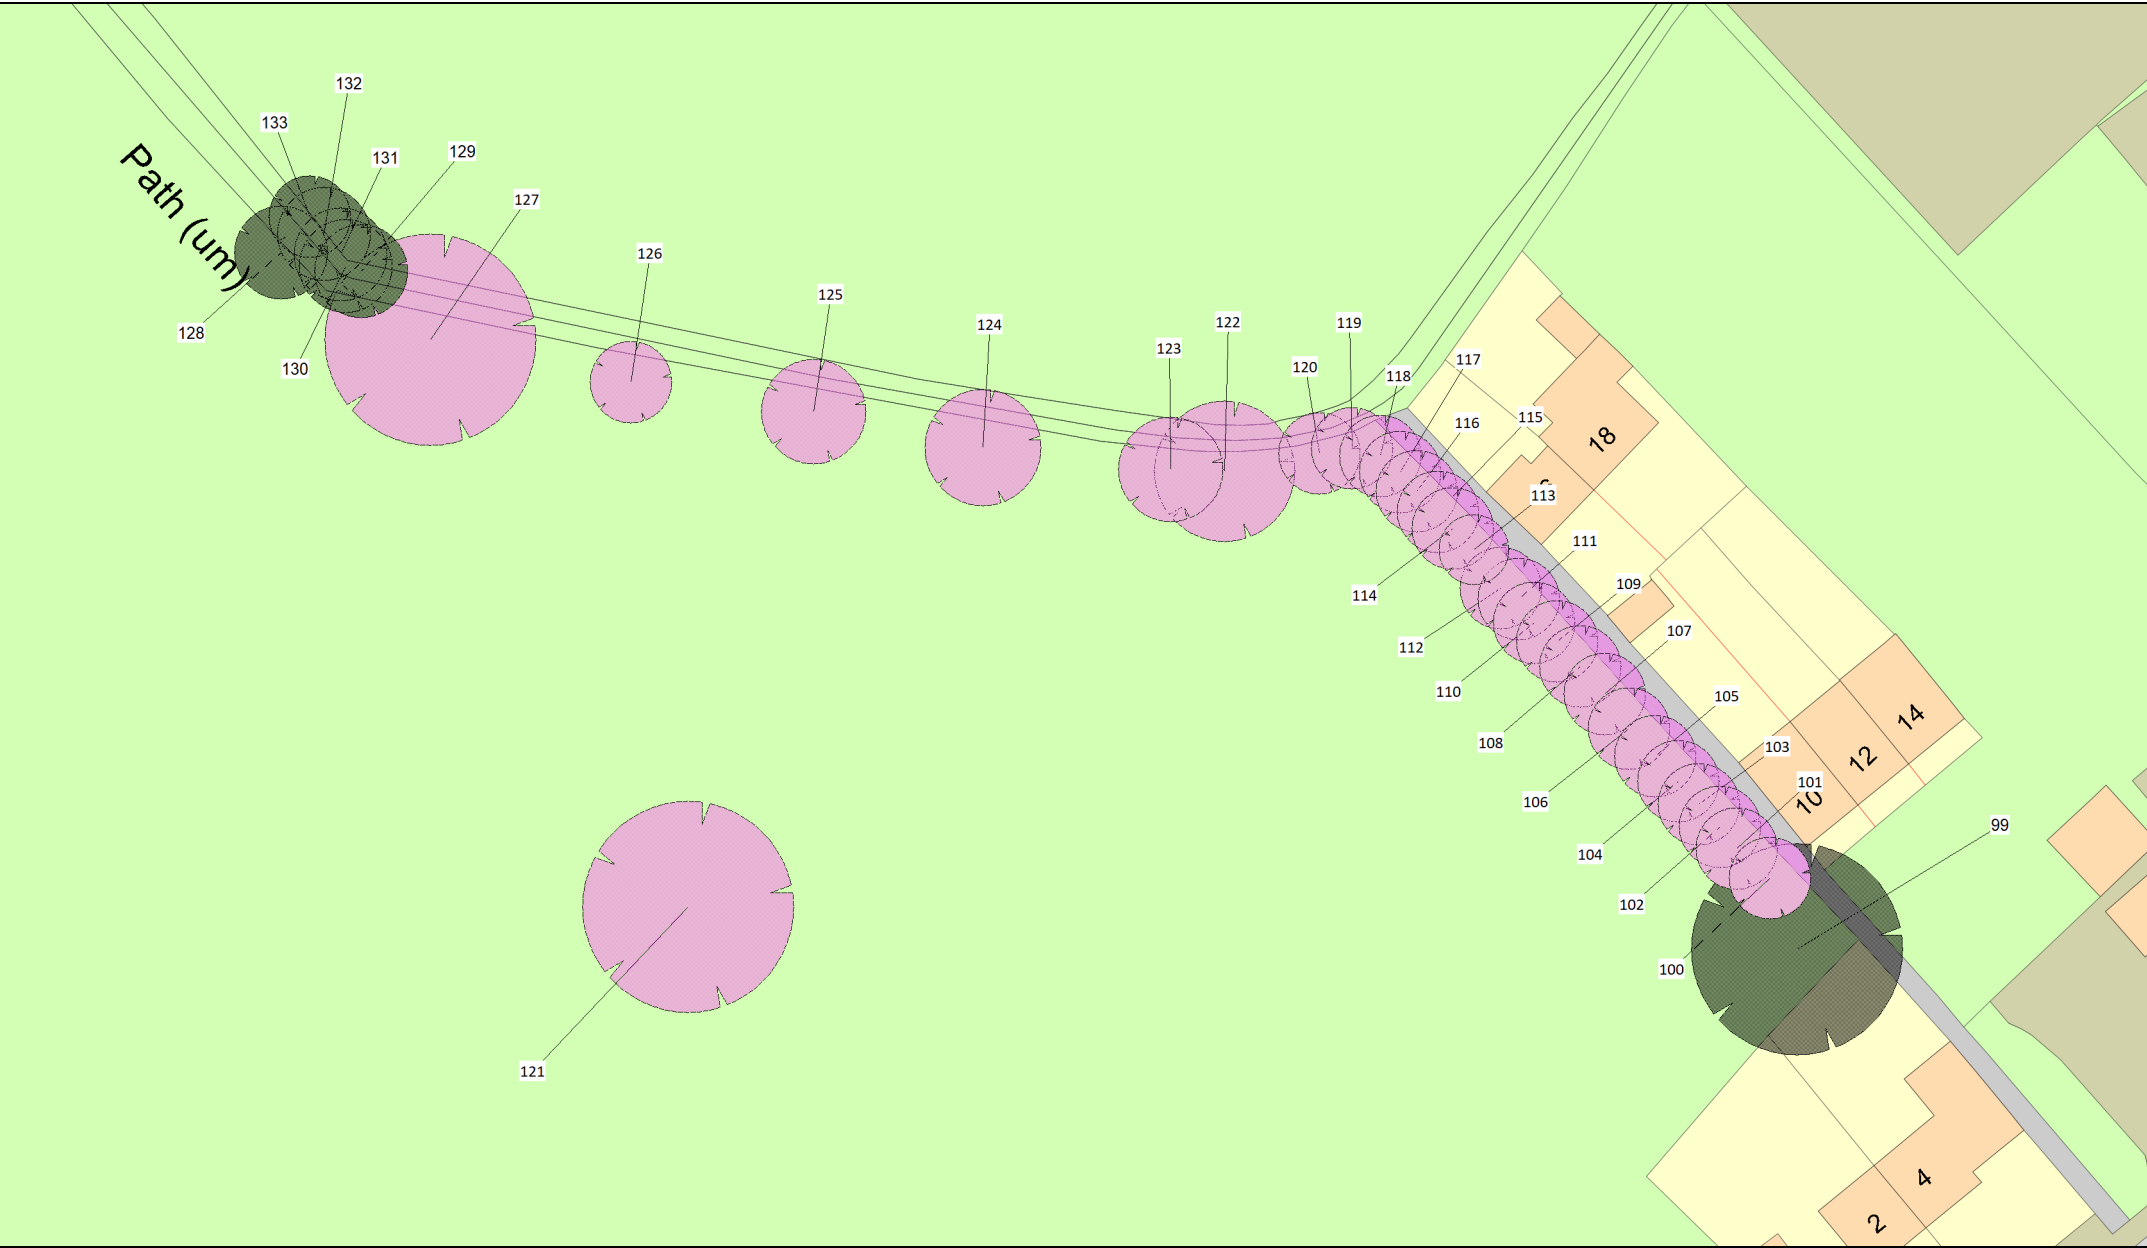

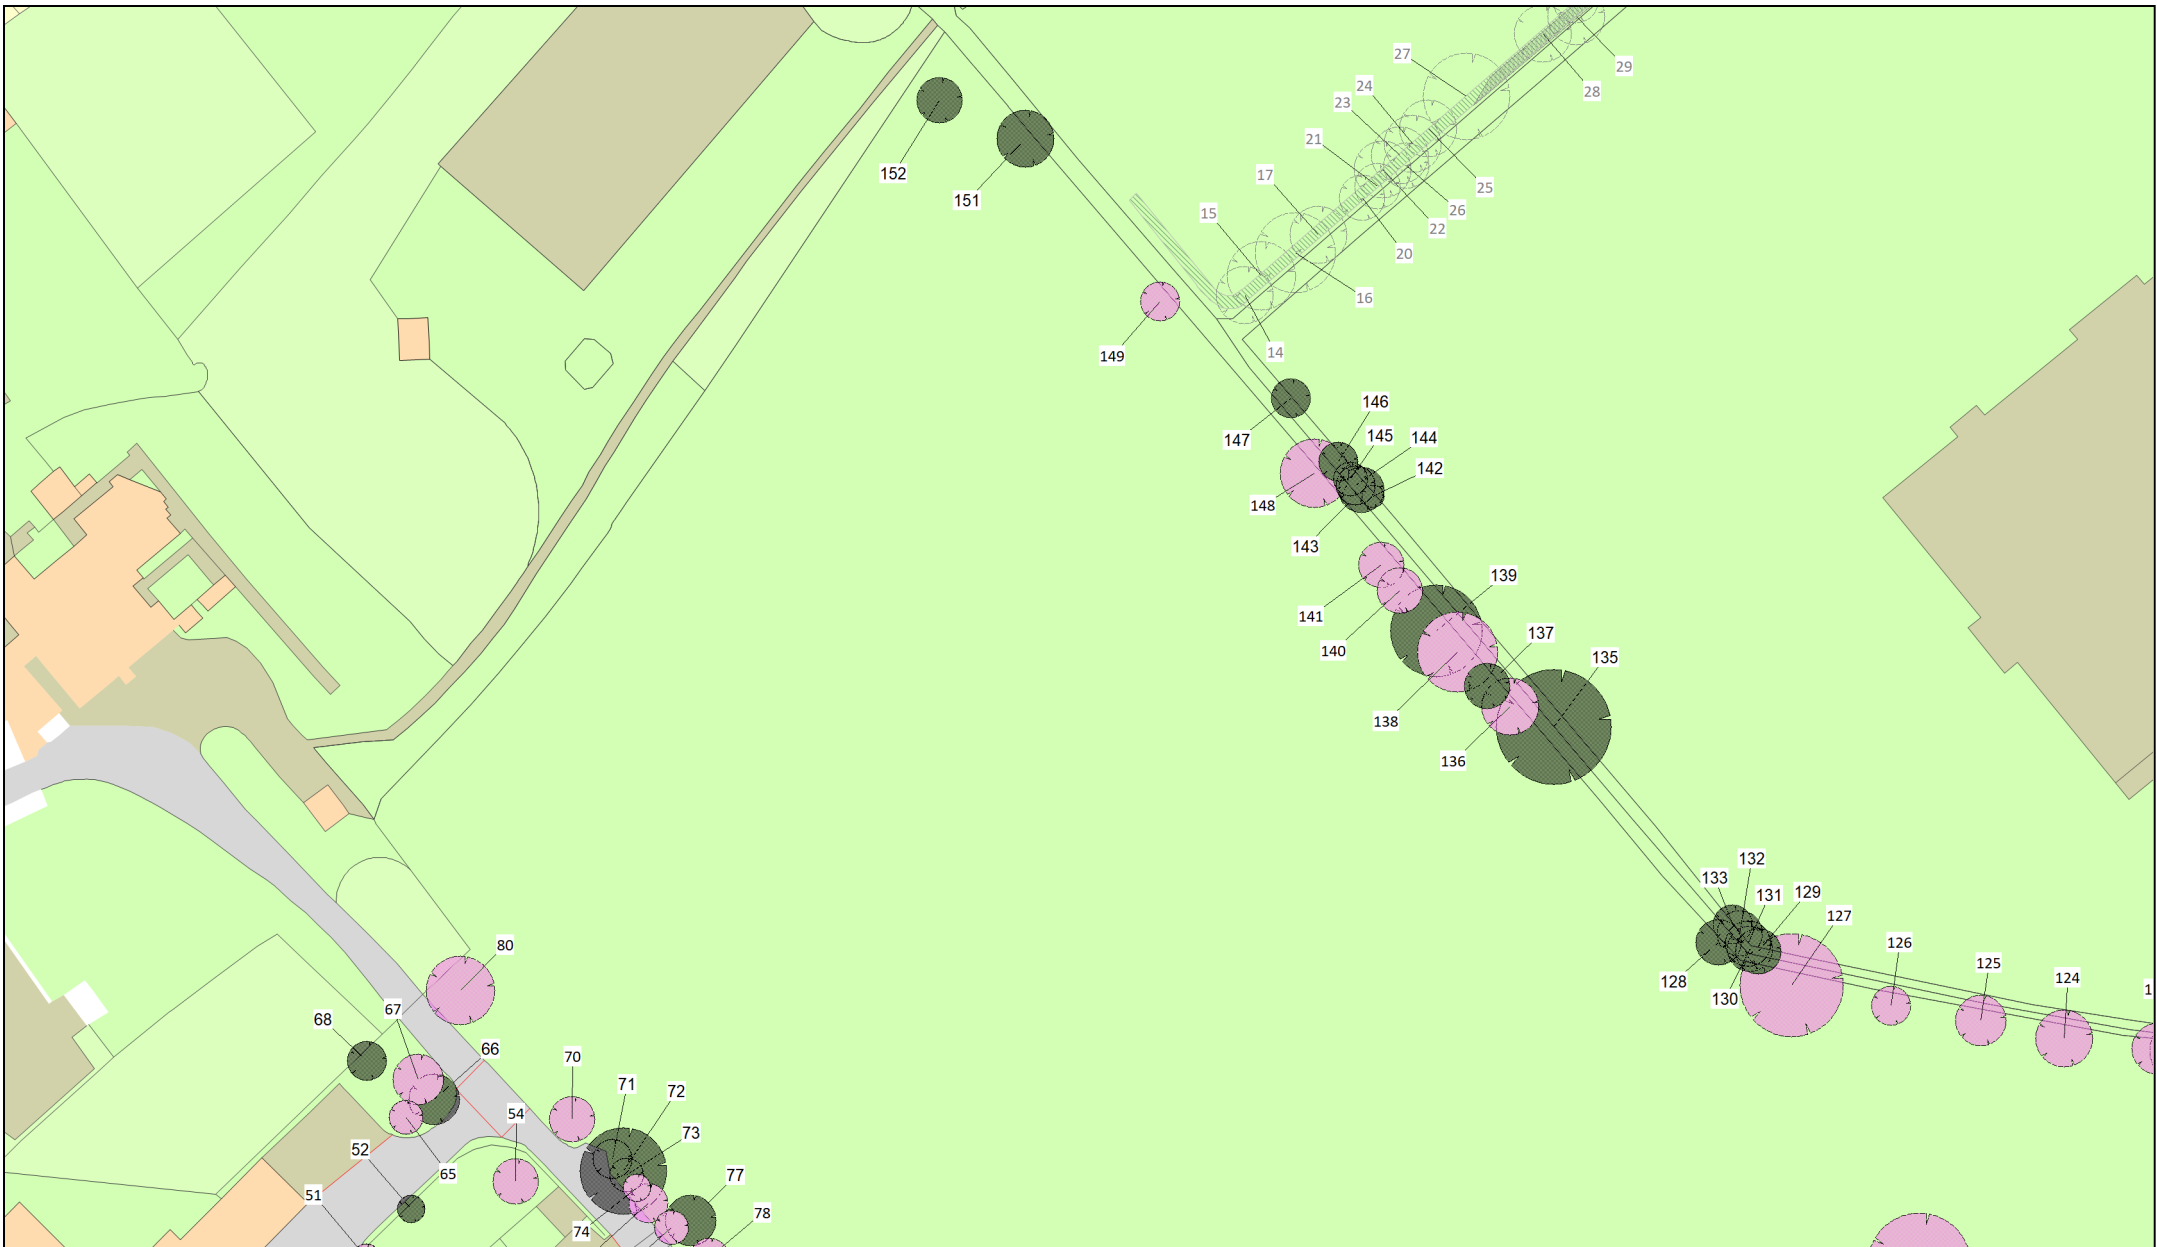

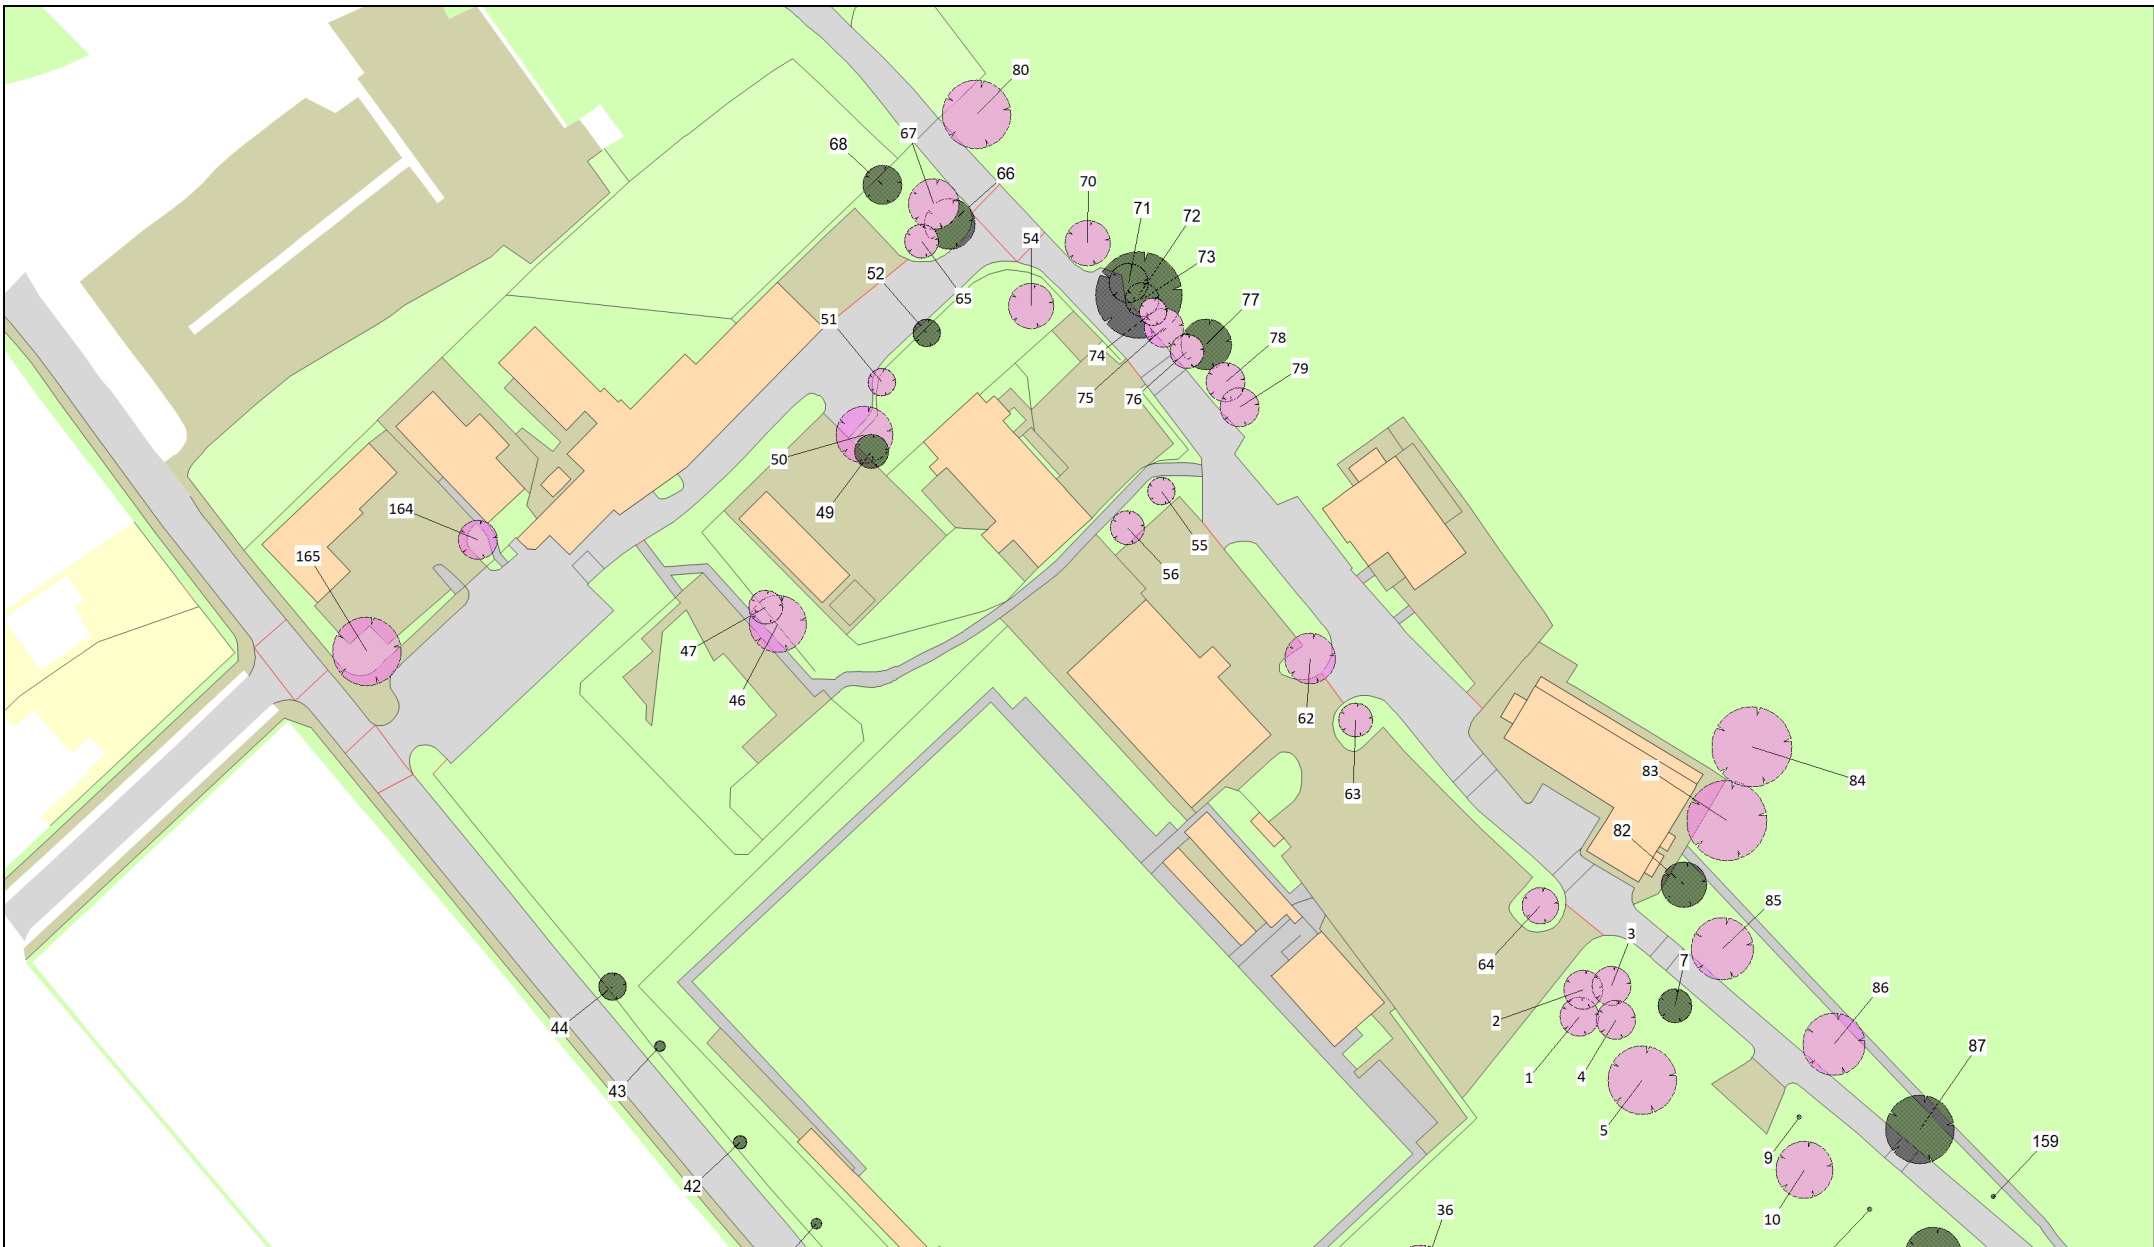



Simon Rogers
Head of Surveying – UK Wide
T: 0345 873 1500
E: simon.rogers@gristwoodandtoms.co.uk

Gristwood and Toms
Harris Lane, Shenley, Radlett
Hertfordshire, WD7 9EG

[www.nurture-group.co.uk/our-brands/
gristwood-and-toms/](http://www.nurture-group.co.uk/our-brands/gristwood-and-toms/)